

Evans Production Co.  
Bullseye #8 D-19-16N-9W

#### Downhole Conditions and Equipment

10 3/4" casing at 60' with 35 cu. ft. of cement  
Circulated to surface  
7 7/8" hole to 732". Not cased

#### Division Approved Plugging Program

1. Mud up, clean out hole to TD and set a cement plug 732'-582'.
2. Wait on cement a minimum of 3 hours. Go in hole with tubing and tag plug #1. If plug is in place go to step 3. If not, fill to 582'.
3. Come out of hole with tubing to 160'. Set a cement plug 160' to surface.
4. Set a dry hole marker, fill pits, clean and level location.

Plugs to be separated with mud weighing a minimum of 9.2 lb/gal.

All plugs will be with neat cement with or without an accelerator.