

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. Santa Fe #1
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No. C-15-25EP
7. Lease Name or Unit Agreement Name Santa Fe
8. Well No. #1
9. Pool name or Wildcat

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Hospah Coal Company
3. Address of Operator P.O. Box 27019, Albuquerque, NM 87125	4. Well Location Unit Letter N : 350 Feet From The South Line and 1670 Feet From The West Line Section 9 Township 19N Range 6W NMPM McKinley County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 6849GL	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

See attached.

RECEIVED
DEC 17 1993
OIL CON. DIV.
DIST. 3

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Gary Simpson TITLE Field Supervisor DATE 12/13/93
TYPE OR PRINT NAME Gary Simpson TELEPHONE NO 505-880-5300

(This space for State Use)

APPROVED BY Denny G. Fount TITLE Deputy Oil and Gas Inspector DATE 2/7/95
CONDITIONS OF APPROVAL, IF ANY:

November 30, 1993

HOSPAH COAL COMPANY
Santa Fe #1 (MV)
350' FSL, 1670' FWL
Sec. 9, T19N, R6W
McKinley County, NM
Lease # C-15-25EP

Page 1 of 1

PLUG AND ABANDONMENT REPORT

Cementing Summary:

- Plug #1** from 2112' to 1340' with 60 sxs Class B cement.
RIH and tag cement at 1451'.
Perforate 2 holes at 150'. Unable to pump into at 700#.
- Plug #2** from 186' to surface with 20 sxs Class B cement inside 4-1/2" casing, circulate good cement to surface.

Plugging Summary:

- 11-22-93 Drive rig and equipment to location. Dismantle flow lines and equipment around wellhead. Spot rig and equipment. SDFN.
- 11-23-93 Safety meeting. Rig up. Change over for rods. Unseat pump and POH with 81 5/8" rods; LD rods and pump. ND wellhead and NU BOP. POH and tally 65 joints 2-3/8" tubing. RIH with open ended tubing to 2112'. Plug #1 from 2112' to 1340' with 60 sxs Class B cement. POH and WOC. RIH and tag cement at 1451'. POH and LD tubing. Perforate 2 holes at 150'. Attempted to pump into holes at 150', pressured up to 700#. Procedure change approved by C. Gholson with NMOC. RIH with tubing to 186'. Plug #2 from 186' to surface with 20 sxs Class B cement inside 4-1/2" casing, circulate good cement to surface. POH and LD tubing. Shut in well and WOC. ND BOP and cut wellhead off; fill casing and install P&A marker with 24 sxs cement. Prepare to rig down and move off location, windy.
- 11-24-93 Check marker and rig down. Move off location.