

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Santa Fe Pacific 29

8. Well No.

44

9. Pool name or Wildcat

Undesignated Dakota

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☒

OTHER

2. Name of Operator

American Cometra, Inc. for
Dakota Resources, Inc.

3. Address of Operator

P.O. Box 906 Sterlings City, Texas 76951

4. Well Location

Unit Letter P : 660 Feet From The South Line and 660 Feet From The East Line

Section 29 Township 17N Range 9W NMPM McKinley County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

7015 Gr.

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

09/11/92 Load hole w/ H₂O, work packer loose, pull 75 jts. 2 3/8" EUE tubing, lay packer down. strap & inspected tubing, back in hole, tag bottom 2375', pick tubing up 2322', break cir. to surface, spot plug #1 2322'-2022' w/ 40 sacks class "B" 2% CaCl. Pull 10 St's, reverse out, W.O.C. 2 Hrs. T.I.H. tag cement @ 2066' pull tubing up to 1500', break cir. to surface, spot plug #2 1500'-1200' pull 10 St's W.O.C. 2 Hrs. T.I.N. tag cement @ 1283', pick tubing up to 460' spot plug #3 460' - to surface w/ 62 sacks class "B" Neat cement. Dig out cellar, cut pipe off 3' below ground, set marker, fill and level pits, clean and reseed location. Ready for inspection.

SEP 17 1992

OIL CON. DIV
DIST. 3

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

D. E. Baxter

TITLE

Agent for

American Cometra, Inc.

DATE 09/16/92

TYPE OR PRINT NAME

Dorle E. Baxter

TELEPHONE NO. 505-681-8887

(This space for State Use)

Original Signed by CHARLES GROLSON

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: