

State of New Mexico
Energy, Minerals and Natural Resources Department
Oil Conservation Division

Sundry Notices and Reports on Wells

<p>1. Type of Well Oil</p> <hr/> <p>2. Name of Operator Robert L. Bayless</p> <hr/> <p>3. Address & Phone No. of Operator P.O. Box 168, Farmington, NM 87499</p> <hr/> <p>4. Location of Well, Footage, Sec., T, R, M Unit M, 990' FSL and 330' FWL Sec. 21, T-16-N, R-6-W, NMPM, McKinley County</p>	<p>API # (assigned by OCD) 30-031-20694</p> <p>5. Lease Number</p> <p>6. State Oil&Gas Lease # 0-9725</p> <p>7. Lease Name/Unit Name Santa Fe Pacific RR</p> <p>8. Well No. #42</p> <p>9. Pool Name or Wildcat Gallup</p> <p>10. Elevation: 6406' GL</p>
---	--

Type of Submission	Type of Action
<input type="checkbox"/> Notice of Intent	<input checked="" type="checkbox"/> Abandonment
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back
	<input type="checkbox"/> Casing Repair
	<input type="checkbox"/> Altering Casing
	<input type="checkbox"/> Other -
	<input type="checkbox"/> Change of Plans
	<input type="checkbox"/> New Construction
	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Conversion to Injection

13. Describe Proposed or Completed Operations

Robert L. Bayless plugged and abandoned this well on August 16, 1999.

8-13-99 Safety Meeting. MO, RU. Unseat pump and LD 27 5/8" rods with pump. ND wellhead and NU BOP. TOH with tubing 22 joints, total 687'. TIH and tag bottom at 781'. Circulate hole clean. Plug #1 with 25 sxs Class B cement with 2% CaCl₂ from 781' to 566'. TOH. SI well and WOC. Tag cement at 602'. TOH and LD tubing. Pressure test to 500# for 5 min, held OK. Perforate 2 squeeze holes at 100'. Establish circulation around 5-1/2" casing with 3 bbls water. Plug #2 with 61 sxs Class B cement from 100' to surface, circulate good cement around 5-1/2" casing. WOC.

8-16-99 Safety Meeting. Tag cement 7' from surface. ND and clean out BOP. Dig out and cut off 5-1/2" casing; found cement at surface. Mix 10 sxs Class B cement and install P&A marker. RD rig and equipment; move off location.
H. Villaneuva, NMOCD, was on location.

SIGNATURE Tom McCarthy Engineer September 14, 1999

(This space for State Use)
Approved by E. Villaneuva

DEPUTY OIL & GAS INSPECTOR, DIST. 3
Title _____ Date SEP 22 1999