## Submit 3 Copies to Appropriate District Office

## State of New Mexico Energy, Minerals and Natural Resources Department

Form C	-103
Revised	1-1-89

DISTRICT I P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION P.O. Box 2088

7.0. DOX 1980, 110001, 14M 88240

Santa Fe, New Mexico 87504-2088

WELL API NO.		
300392097400	01	
5 Indicate Type of Lease		

P.O. Drawer DD, Artesia, NM 88210 FEE X STATE 1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil & Gas Lease No. SUNDRY NOTICES AND REPORTS ON WELLS ( DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) Regina Type of Well: WELL X WELL OTHER Name of Operator 8. Well No. Texaco Exploration & Production, Inc. 3. Address of Operator 9. Pool name or Wildcat 3300 North Butler, Farmington, New Mexico 87401 (505)325-4397 South Blanco-Pictured Cliffs 4. Well Location D 790 North 890 West Unit Letter Feet From The Line and Feet From The Line 17 23N 1W Rio Arriba Section Township Range **NMPM** County 10. Elevation (Show whether DF, RKB, RT, GR, etc.) 7450' GR Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: ND ABANDON REMEDIAL WORK **ALTERING CASING** £ 1993 CHANGE PLANS COMMENCE DRILLING OPNS. **PLUG AND ABANDONMENT** CASING TEST AND CEMENT JOB DIST. OTHER: OTHER:

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Texaco E. & P. Inc. has Plugged & Abandoned the subject well. The following procedure was followed:

7-08-93. MIRUSU. RU & ran freepoint on 2-7/8" casing. Stuck @ 350'. RU & pumped 65 sxs cement into perfs. Perfs taking cement on vacuum. Pumped 10 BBLS of water. SI for 1 hr. Open well and still on vacuum. Pumped 20 sxs cement when psi jumped to 1000#. Perfs were squeezed off. GIH with tbg to TOC @ 2790'. Circulated cement out of hole. Circulate clean. RU & tagged cement @ 2790'. Ran CBL log and found TOC outside 2-7/8" casing @ 1920'. Perfed two squeeze holes @ 150'. GIH to 2970' and spotted 55 sxs cement from 2970' to 150'. POOH with tbg. RU & pumped 50 sxs cement and circulated 3 BBLS of good cement up bradenhead. RDMOL. Clean up location. Charles Gholson with NMOGCD instructed on procedures when casing could not be retrieved. 7-14-93. Plugged and Abandoned.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.  SIGNATURE COURT FLORIC TAT TITLE Area Manager  DATE 7/21/93				
SIONATURE ROCKER FLINCE TAT	—— mie —————————————————————————————————	DATE		
TYPEORPRINT NAME		TELEPHONE NO.		
(This space for State Use)				
APPROVED BY Jack Griffin	protection of CAS WAVECTON CO.	DATE 09-30-93		

MOCD (3) TAT DDII DES MAG

CONDITIONS OF AFFROVAL, IF ANY: