Form 3109-5 (November 1983) (Formerly 9-331)	UNITED STATES DEPARTMENT OF THE INTER BUREAU OF LAND MANAGEMEN		5. LEASE DESIGNATION AND SERIAL NO NM-045884-A
	NOTICES AND REPORTS  m for proposals to drill or to deepen or plug  m "APPLICATION FOR PERMIT—" for such	, back to a different reservoir.	6. IF INDIAN, ALLOTTEE OR TRIBE NAM
P. O. Box 8	oTHER  6 GAS CORPORATION  40, Farmington, NM 87499  ort location clearly and in accordance with an		7. UNIT AGRESMENT NAME  8. FARM OR LEASE NAME Federal Media 9. WELL NO.  8 10. FIELD AND POOL, OR WILDCAT
See also space 17 below.) At surface  660 FNL & 660 FEL  14. PERMIT NO.   15. BLEVATIONS (Show whether DF, BT, GR, etc.)			Undesignated Mesaver  11. SEC, T, E, M., OR BLE. AND SURVEY OR AREA  Sec 22, T19N, R3W  12. COUNTY OR PARISH 13. STATE
TEST WATER SHUT-OFF FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WELL (Other)	Check Appropriate Box To Indicate  ICE OF INTENTION TO:  PULL OR ALTER CASING MULTIPLE COMPLETE ABANDON* CHANGE PLANS  MPLETED OPERATIONS (Clearly state all pertine li is directionally drilled, give subsurface loc	WATER SHUT-OFF  FRACTURE TREATMENT SHOOTING OR ACIDIZING  (Other)  (NOTE: Report result Completion or Recomp	REPAIRING WELL ALTERING CASING ABANDONMENTS  a of multiple completion on Well bletion Report and Log form.)
The p	roposed P&A was completed o hed is a well history for y		

SIGNED George F. Sharpe	TITLE Engineer	DATE 12-17-90
(This space for Federal or State office use)	Acting AREA MANAGER RIO PUERCO RESOURCE AR	DATE 12-24-90
CONDITIONS OF APPROVAL, ANY:	NMOCD	Taxes - 1 Acct - 1
	*See Instructions on Reverse Side	Land - 1 Copies: BLM - 6 Rio Puerco

## FEDERAL MEDIA NO. 8

## On Report

December 7, 1990 Day No. 1

Summary: Start plugging procedure.

Detail: Move Bedford on location and RU. Start out of hole,

laying dn rods. SDON. (ARM)

December 8, 1990 Day No. 2

Summary: Continue plugging operations.

Detail: POH laying dn rods and plunger. ND wellhead. NU BOP. POH w/ 2-3/8" tbg and tbg barrel. TIH to 1730'. Spot a 57 sk cement plug over MV perfs to 1000'. Pull above cement. SDON.

(ARM)

## Off Report

December 10, 1990 Day No. 3

Summary: Finish plugging procedure.

Detail: TIH, tag cement at 1000' - mix 9 ppg mud, roll hole with mud. Pull tbg to 442', spot 34 sx cement plug to surface. POH, could not pump in casing annulus. ND BOPs. Cut off csg. Installed dry hole marker. RDMO. (ARM)