(November 1983) (Formerly 9–331) DEPARTME	NITED STATES  SUBMIT IN TRIPE (Other Instructions OF THE INTERIOR verse side) OF LAND MANAGEMENT	Budget Bureau No. 1004-0135 Expires August 31, 1985  5. LEASE DESIGNATION AND SERIAL NO. NOO-C-1420-5942 5042
	ES AND REPORTS ON WELLS	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
(140 not use this form for proposals Use "APPLICATI	Glin-hos-pah Tomas	
OIL GAS OTHER		\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
2. NAME OF OPERATOR		S. FARM OR LEASE NAME
Robert L. Bayless		Glin Tomas
3. ADDRESS OF OPERATOR	07/00	#1
P.O. Box 168, Farming	ton, NM 8/499	
See also space 17 below.) At surface	rly and in accordance with any State requirements.	
790' FSL & 183.	5' FWL MOV 2 7 1384	11. SEC., T., E., M., OR BLK. AND SURVEY OR AREA
	PUREAU OF LAND MANAGE	Sec. 22, T22N, R6W
14. PERMIT NO.	15. ELEVATIONS (Show whether DE ET. TRE ELECTION INC. L.	12. COUNTY OR PARISH 13. STATE Sandoval NM
14. Check Appr	opriate Box To Indicate Nature of Notice, Repo	ort, or Other Data
NOTICE OF INTENTIO	ON TO:	SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF PUL	LL OR ALTER CASING WATER SHUT-OFF	BEFAIRING WELL
	LTIPLE COMPLETE PRACTURE TREATMI	
B	ANGE FLANS (Other) Hot	oil_well
REPAIR WELL CH.	(Norz: Repo	rt results of multiple completion on Well r Recompletion Report and Log form.)
nent to this work.) *		
SEE ATTAC	CHED SHEET.	
		OIL CON DIV.
SIGNED (11 W) (This space for Federal or State office	TITLE Petroleum Enginee	NOV 29 1984
APPROVED BY	TITLEY:	FARMINGTUN, KESUUKUE AR
		ВУ
	*C. I. t. t. a. on Poures Side	

Title 18 U.S.C. Section 1001, makes it a crime for any person thowardly and willfully to make to any department or agency of the United States any faise, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

\*See Instructions on Reverse Side

11/19/84 Moved in and rigged up Bayless Rig 6. Attempted to pull rods and pump. Pulled rods out of hole. Rod pulled out of rod box. SDFN.

11/20/84 Tripped rods in hole. Screwed on to fish. Could not unseat pump. Started stripping rods and tubing out of hole. SDFN.

11/21/84 Stripped remaining rods & tubing from hole. Pump: was stuck in seating nipple. Replaced 1 bad joint of 2-3/8" tubing. Ran 2-3/8" tubing back in hole and landed as follows:

DESCRIPTION	LENGTH	<u>DEPTH</u>
KB to Landing Point	10.80	0-11
163 jts 2-3/8" 4.7#/ft 8rd J55 EUE tbg	5247.01	11-5258
1 25/32" seating nipple	.75	5258-5259
1 2-3/8" perforated sub	3.10	5259-5262
1 jt 2-3/8" tubing	32.57	5262-5294
l bullplug	. 25	5294-5294
	5294.48	

Hot oiled tubing to remove paraffin. SDFN.

11-22-84 Shut down. Thanksgiving.

11-23-84 Tripped pump and rods in hole. Changed out 1-5/8" rod. Landed pump as follows:

DESCRIPTION	LENGTH	DEPTH
KB to landing point	8.00	0-8
1 ¼" polished rod	16.00(7' out)	8-17
1 3/4" pony rod	7.00	17-23
65 3/4" rods	1625.00	23-1648
144 5/8" rods	3600.00	1648-5248
2" X 1-1/16" X 10' pump (bottom		
hold down) w/ gas anchor	10.00	5248-5258
-	5258.00	

Hung off well. Started pumping unit. Released rig.