

OIL CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. LG 2875

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P&A Well	7. Unit Agreement Name
Name of Operator Yates Petroleum Corporation	8. Farm or Lease Name Lumbre ACP State
Address of Operator 207 South 4th St., Artesia, NM 88210	9. Well No. 1
Location of Well UNIT LETTER A 858 FEET FROM THE North LINE AND 990 FEET FROM THE East LINE. SECTION 16 TOWNSHIP 19N RANGE 2W NMPM.	10. Field and Pool, or wildcat Wildcat Gallup
11. Elevation (Show whether DF, RT, GR, etc.) 6967' GR	12. County Sandoval

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Propose to plug and abandon well as follows:

- 1) Pull production equipment and tubing.
- 2) Set CIBP at 3185' and cap w/50' of cement.
- 3) Cut and pull 4 1/2" casing from approximately 2380' (50' above cement top).
- 4) Spot 100' cement plug 50' in and out of 4-1/2" stub.
- 5) Spot 100' cement plug inside 7" casing across surface casing. Shoe depth from 322' to 222'.
- 6) Put 10 sx plug at surface and install regulation abandonment marker.

NOTE: Plugs in steps (4) and (5) shall consist of a minimum of 35 sacks of cement.

NOTE: Notify NMOCD, Aztec, in time to witness plugging operations.

Verbal approval for plugging procedure above given by Mr. Charlie Gholson, NMOCD, Aztec, to Ray Stall on 10-2-85.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original Signed by CHARLES GHOLSON	TITLE Production Supervisor	DATE 10-2-85
PROVED BY	DEPUTY OIL & GAS INSPECTOR, DIST. #3	DATE OCT - 3 1985

CONDITIONS OF APPROVAL, IF ANY: