UNITED STATES DEPARTMENT OF THE INTERIOR (Other instructions on reverse side)

SUBMIT IN TRIPLICATE.

Form approved. Budget Bureau No. 42-R1424. 5. LEASE DESIGNATION AND SERIAL NO.

SF078924

Inctall blow-out-preventors.

GEOLOGICAL SURVEY 6. IF INDIAN, ALLOTTEE OR TRIBE NAME SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.

Use "APPLICATION FOR PERMIT" for such proposals.) 7. UNIT AGREEMENT NAME WE'L X OTHER 8. FARM OR LEASE NAME 2. NAME OF OPERATOR Connie Petroleum Consultants, Inc. 9. WELL NO. 3. ADDRESS OF OPERATOR 1420 Carlisle Blvd., NE Suite 202, Albuquerque, NM 87110 10. FIELD AND POOL, OR WILDCAT LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface Escrito <u>Gallup</u> 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 1850' FNL & 1650' FEL 21, T24N, R7W
12. COUNTY OR PARISH 13. STATE 15. ELEVATIONS (Show whether DF, RT, GR, etc.) 14. PERMIT NO. New Mexico Rio Arriba 7111 KB & 7100 GR Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data 16. SUBSEQUENT REPORT OF: NOTICE OF INTENTION TO REPAIRING WELL WATER SHUT-OFF PULL OR ALTER CASING TEST WATER SHUT-OFF ALTERING CASING FRACTURE TREATMENT MULTIPLE COMPLETE FRACTURE TREAT ABANDONMENT* SHOOTING OR ACIDIZING ABANDON* SHOOT OR ACIDIZE CHANGE PLANS REPAIR WELL (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

(Other) 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9-20-76	Move in - rig up putting unit. This car, blow out provided
•	Pull rods and tubing
9-21-76	Run retreivable bridge plug and Fullbore cementer to locate hole in casing. Set bridge plug at 5577'. Unable to locate holes precisely as packer stuck at 5406'. Holes above 5406'.
9-22-76	Attempt to work packer loose - unsuccessful.
9-23-76	Attampt to work packer loose - unsuccessful.
9-24-76	Attament to work packon loose - unsuccessful. Dack off cubing
9-24-70	at 5372'. Left junk in hole as follows: I joint tubing 5372-5400;
9-25-76	Plugged and abandoned well. Refer to abandonment notice for details.

	/ ^F			
	; !			
	1	and Japan		
18. I hereby certify that the foregoing true and correct	MTLE Åge	ent	DATE	9-27-76
(This space for Federal or State office use)				
APPROVED BY	ritle		DATE	