Budget Bureau No. 1004-0135 UNITED STATES

SUBMIT IN TRIPLICATE®
(Other instructions on reverse side) Form 3160-5 Expires August 31, 1985 (November 1983) 5. LEASE DESIGNATION AND SERIAL NO. (Formerly 9-331) BUREAU OF LAND MANAGEMENT Jic Contr. 13 6. IF INDIAN, ALLOTTEE OR TRIBE NAME SUNDRY NOTICES AND REPORTS ON WELLS (Do not use this form for proposals to drill or to deepen or Use "APPLICATION FOR PERMIT—" for Jicarilla Apache OIL X GAS WELL AUG 1 - 1985 OTHER R PARM OR LEASE NAME NAME OF OPERATOR OIL CON. DIV J, Apache "C" Amerada Hess Corporation 9. WBLL NO. 3. ADDRESS OF OPERATOR Drawer D, Monument, New Mexico 88265

Location of Well (Report location clearly and in accordance with any State requirements.

See also space 17 below.) 10. FIRLD AND POOL, OR WILDCAT Basin Dakota/Otero Gallup 11. SEC., T., E., M., OR BLK. AND SURVEY OR AREA JUL 22 1985 890' FNL & 1750' FEL BUREAU OF LAND MANAGEMENT Sec. 27, T24N, P5W 15. ELEVATIONS (Show whether Spice CR. SOURCE AREA 12. COUNTY OR PARISH | 18. STATE 14. PERMIT NO. N.M. 6680' GL Rio Arriba Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data 16 NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REPAIRING WELL PULL OR ALTER CASING WATER SHUT-OFF TEST WATER SHUT-OFF PRACTURE TREATMENT ALTERING CASING FRACTURE TREAT MULTIPLE COMPLETE SHOOTING OR ACIDIZING ABANDON MENT ABANDON* SHOOT OR ACIDIZE (Other) Progress report CHANGE PLANS REPAIR WELL (NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) (Other) 17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and sones pertinent to this work.) June 4, 1985 - Pulled 1-1/2" tbg., ran gauge ring & junk basket in 5-1/2" csg. to 6700' & set retrievable bridge plug in 5-1/2" csg. at 6015' isolating Dakota zone 5-1/2" csg. perf. fr 6692' to 6727'. Dumped sand on top of bridge plug. Loaded 5-1/2" csg. w/2% KC1 water & teste bridge plug w/500# press. Held OK. Ram strip log fr. 5800' to 5500' & perf. 5-1/2" csg. opposite Callup zone fr. 5620' to 5630', 5640' to 5650' & fr. 5656' to 5666' w/2 SPF. Frac-ed Callup zone thru 5-1/2" csg. perf. fr. 5620' to 5666' w/1800 bbls. 2% gelled KCl water & 100,000# 20/40 sand, w/additives. Flowed back water & sand. Ran 2-7/8" tbg. & checked top of sand inside 5-1/2" csg. at 5735'. Pulled & laid down rental 2-7/8" tbg. Picked up & ran 2-3/8" tbg., steam cleaned tbg. in process. Ran pump & rods, moved in pump unit & gas engine. Connected pump unit & gas engine. Attempted to pump. No results. Pulled rods & pump & hot oiled tbg. Re-ran pump & rods. Attempted to start pumping & found oil line leak at separator Repaired same & attempted to pump. No results. Pulled rods, pump & tbg. & found mud anchor plugged w/paraffin. Re-ram tbg., pump & rods & started pumping load. Recovered load and resumed production pumping from Gallup zone 5-1/2" csg. perf. fr. 5620' to 5666'. July 12, 1985 - Pulled rods & repaired pump. July 17, 1985 - Pulled rods, pump & tbg. & cleaned out fill w/hydrostatic bailer fr. 5710' to 5882'. Re-ran tbg., pump & rods & resumed production.

Plan to make application to N.M.O.C.D. to down-hole commingle Dakota and Gallup production.

18. 1 hereby certify that the foregoing in trye and correct

SIGNED 2/3 July

TITLE Supv. Adm. Ser.

ACCEPTED TOR RECORD

(This space for Federal or State office use)

 B ______ BALUL 3 1 1985

*See Instructions on Reverse Side