PRILLING SCHEDULE - ARIZONA JICARILLA "A" #5

Cementing

8-5/8" Surface Casing:

85 sacks (100 cu.ft.) Class "B" with 1/4# gel flake per sx and 3% CaCl₂. WOC 12 hours. Test to 600# prior to drilling out.

2-7/8" Production Casing: 395 sacks 50/50 Class "B" Poz with 6% gel mixed with 7.87 gals water per sack followed by 50 sacks Class "B" with 2% CaCl₂. (675 cu.ft.). If lost circulation is encountered while drilling add 1/4 cu.ft. fine gilsonite per sack. Run temperature survey 8 hours after plug down.