

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

RECEIVED

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐	2. NAME OF OPERATOR Conoco Inc.	3. ADDRESS OF OPERATOR P.O. Box 460 - Hobbs, New Mexico 88240	4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 820' FNL & 610' FNL - Unit Letter D	5. LEASE DESIGNATION AND SERIAL NO. Contract 65	6. IF INDIAN, ALLOTTEE OR TRIBE NAME Sicilla Apache	7. UNIT AGREEMENT NAME	8. FARM OR LEASE NAME Sicilla 22	9. WELL NO. 10	10. FIELD AND POOL, OR WILDCAT West Lindlithy / Gallup	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 21-25N-4W	12. COUNTY OR PARISH La Arriba	13. STATE NM
14. PERMIT NO. 30-039-22025	15. ELEVATIONS (Show whether DP, RT, CR, etc.)											

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

MIRU. Work started on 7/22/87. Tag fill at 7291'. Drill out hard fill from 7291'-7981'. Blew hole clean. TTH w/RBP & pke. Stacked out at 7844'. POOH. Tag fill at 7844'. Clean out fill to PBTD w/N₂. TTH w/RBP & pke. Stacked out at 7890'. Swabbed well. Run in hole w/CIBP. Plug hung at 7200'. Mill out CIBP at 7668'. Fill at 7386'. Clean out to CIBP. Drilled thru CIBP & ran to bottom. Tag at 7934'. POOH. Set CIBP at 7895'. POOH. Set RBP at 7869' & pke at 7624'. Acidize Dakota w/24 bbls 15% HCl w/800 scf N₂/bbl flush w/50 bbl N₂; Shut down 1/2 hr & flow back till dead. Attempt to get RBP when using N₂. Stack out 8' high, move pke to 6785'. Acidize Gallup w/24 bbl 15% HCl w/800 scf N₂/bbl. Flush w/50 bbl N₂. Shut down 1/2 hr & flow back till dead. POOH w/Hg & pke. Tag fill. Pump 35 bbl produced water. POOH. Land Hg at 7852'. Unload well w/N₂. Swab well. Left well plug to tank.
Work Completed 9/2/87.

18. I hereby certify that the foregoing is true and correct

SIGNED W. H. Finn

TITLE Administrative Supervisor

DATE December 14, 1987

(This space for Federal or State office use)

APPROVAL BY
CONDITIONS OF APPROVAL, IF ANY:

TITLE

ACCEPTED FOR RECORD

DEC 30 1987

FARMINGTON RESOURCE AREA

*See instructions on Reverse Side

Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

BLM - Carlsbad (6) File