3 OCD 1 DE l File State of New Mexico Submit 3 Copies Form C-103 Energy, Minerals and Natural Resources Department to Appropriate District Cifice Revised 1-1-89 DISTRICT I P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION WELL API NO. P.O. Box 2088 30-03<u>9-22495</u> DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088 5. Indicate Type of Lease FEE L STATE DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410 6. State Oil & Gas Lease No. SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: WELL. WELL V JELLY DOG JERRY 2. Name of Operator 8. Well No. OGRID # 015515 NASSAU RESOURCES, INC. Address of Operator 9. Pool name or Wildcat P O BOX 809, Farmington, N.M. 87499 So. Blanco PC 4. Well Location G : 1520 Feet From The North __ Line and _1850_ Feet From The __ East Line Section thip 24N Range 2W 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Township Rio Arriba **NMPM** County 7148' GL Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data **NOTICE OF INTENTION TO:** SUBSEQUENT REPORT OF: PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK **ALTERING CASING TEMPORARILY ABANDON CHANGE PLANS** COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **PULL OR ALTER CASING** CASING TEST AND CEMENT JOB OTHER: OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. Well was plugged and abandoned on 7/28/94 per attached copy.

I hereby certify that the information above is true and complete to the best of my knowledge and belief. TIME_Field_Supt SIGNATURE 505 TYPE OR PRINT NAME Murphy Brasuel TELEPHONE NO. 326-7793

(This space for State Use)

THE 0,14 Gas Inspector DATE 8-25-94

NASSAU RESOURCES, INC.

Jelly Dog Jerry #2 (PC) 1520' FNL & 1850' FEL Sec.33, T24N, R2W Rio Arriba County, NM FEE

PLUG AND ABANDONMENT REPORT

Cementing Summary:

Plug #1 with 22 sxs Class B cement from 3013' to 2722' over Pictured Cliffs perfs.

Plug #2 with 22 sxs Class B cement inside casing from 2851' to 2565' over Fruitland and Ojo Alamo zones.

Plug #3 with 47 sxs Class B pumped down 4-1/2" casing from 189' to surface, circulated 1 bbl good cement out bradenhead.

Plugging Summary:

- 7-27-94 Drive rig to location. Rig up. Pressures: casing 200#, tubing 100#. Lay out relief lines and bleed well down. Pump 10 bbls water down Pictured Cliffs tubing to kill well. ND wellhead. NU BOP. PU and RIH with 1 jt 1-1/4" tubing and tag bottom of well at 3030'. POH to 3013'. Plug #1 with 22 sxs Class B cement from 3013' to 2722' over Pictured Cliffs perfs. POH to 1985'. Shut in well, WOC. SDFN.
- 7-28-94 Safety Meeting. Open up well, no pressure. RIH and tag of cement at 2869'. POH to 2851'. Load well with 15 bbls water and pressure test casing to 500#, held OK. Plug #2 with 22 sxs Class B cement inside casing from 2851' to 2565' over Fruitland and Ojo Alamo zones. POH and LD tubing. Perforate 2 squeeze holes at 189'. Establish circulation out bradenhead with 5 bbls water. Plug #3 with 47 sxs Class B pumped down 4-1/2" casing from 189' to surface, circulated 1 bbl good cement out bradenhead. Shut in well, WOC. ND BOP and cut off well head. Install P&A marker with 15 sxs Class B cement. Rig down and move off location.