

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 1004-0135
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	5. LEASE DESIGNATION AND SERIAL NO. NM013480
2. NAME OF OPERATOR Consolidated Oil & Gas, Inc.	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR PO Box 2038, Farmington, New Mexico 87499	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 990' FNL & 1650' FWL	8. FARM OR LEASE NAME LADD
RECEIVED JUL 12 1984 BUREAU OF LAND MANAGEMENT FARMINGTON RESOURCE AREA	9. WELL NO. 1
	10. FIELD AND POOL, OR WILDCAT Basin Dakota
	11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 19, T25N, R9W
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6754' GR
	12. COUNTY OR PARISH San Juan
	13. STATE N.M.

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
(Other)

PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
ABANDON* ☐
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐
FRACTURE TREATMENT ☐
SHOOTING OR ACIDIZING ☐
(Other)

REPAIRING WELL ☐
ALTERING CASING ☐
ABANDONMENT* ☒

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

7-6-84 MIRU. Bleed well down. PU 1 jt of 1-1/2" tbg, tag up. Pump 10 bbl water down tubing. Set plugs as follows:
Cmt perfs 6400 to 6521' w/ 18 cu ft C1"B" w/ 2% CaCl₂
Cmt perfs 5370 to 5470' w/ 18 cu ft " "
Cmt perfs 3432 to 3532' w/ 18 cu ft " "
Cmt perfs 1893 to 1993' w/ 18 cu ft " "
Cmt perfs 1047 to 1347' w/ 31 cu ft " "
Cmt perfs surface to 308' w/ 31 cu ft " "
Set 12 cu ft plug in top of casing
Laid down 201 jts of 1-1/2" tbg as plugs set
Cut off wellhead, set P & A marker.

RECEIVED
JUL 16 1984
OIL CON. DIV.
DIST. 3

18. I hereby certify that the foregoing is true and correct

SIGNED Barbara C. Roy

TITLE Prod. & Drlg. Technician DATE 7-11-84

(This space for Federal or State office use)

ACCEPTED FOR RECORD

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

JUL 13 1984

NMOCC

*See Instructions on Reverse Side

FARMINGTON RESOURCE AREA

BY [Signature]