Form 9-331 (May 1963)	UNIT	ED STATES	SUBMIT IN TRIPLICATE*	Form approved. Budget Bureau 1	No. 42-R1424	
		DEPARTMENT OF THE INTERIOR (Other instructions on re-			5. LEASE DESIGNATION AND SERIAL NO.	
GEOLOGICAL SURVEY				SF 078155		
		AND REPORTS C rill of to deepen or plug be OR PERMIT—" for such pre	ON WELLS ack to a different reservoir. oposals.)	6. IF INDIAN, ALLOTTEE OR	TRIBE NAME	
1. OIL GAS WELL X WELL OTHER				7. UNIT AGREEMENT NAME		
2. NAME OF OPERATOR				8. FARM OR LEASE NAME		
GULF OIL CORPORATION				West Bisti Unit		
3. ADDRESS OF OPERATOR				9. WELL NO.		
P. O. Box 670, Hobbs, NM 88240				160		
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface				10. FIELD AND POOL, OR WILDCAT		
				Bisti Lower Gallup		
	660' FNL & 198	30' FWL		11. SEC., T., R., M., OR BLK. SURVEY OR AREA	AND	
				Sec. 1-25N-13W		
14. PERMIT NO.	15. Eti	15. ELEVATIONS (Show whether DF, RT, GR, etc.)		12. COUNTY OR PARISH 13. STATE		
		6211' GL		San Juan	NM 	
16.			ature of Notice, Report, or C			
	NOTICE OF INTENTION TO:	,	co	TENT REPORT OF:		
TEST WATER SHUT-	DEF IIIL OR .	ALTER CASING	WATER SHUT-OFF	REPAIRING WELI	r	
FRACTURE TREAT	MULTIPLE	COMPLETE	FRACTURE TREATMENT	ALTERING CASIN	· -	
SHOOT OR ACIDIZE	ABANDON*		shooting or acidizing (Other) Clean out	ABANDONMENT®		
REPAIR WELL (Other)				of multiple completion on vetion Report and Log form.)	Well	
17. DESCRIBE PROPOSED (proposed work. I nent to this work.)	R COMPLETED OPERATIONS f well is directionally dri	(Clearly state all pertinent fled, give subsurface locati	details, and give pertinent dates, ons and measured and true vertice			
Pull rods &	numn: check for	fill with tubin	g (88' of fill). POR	H with tubing. R	an bit	
on 2-3/8" tu	bing. Clean out	t fill - large a	mounts of iron sulfic	de. Drill plug,	chased	
nlug to 4948	' (new PBTD). I	Finish drilling	on plug. POH with to	ubing & bit. Run	tubing,	
seating nipp	le & anchor. Ru	un pump & rods.	Hang well back on.	Move pump pit &	swivel	
off location	. PNG until 6-	18-80. Pumped 1	.7 BO & 74 BW in 24 hi	rs after work. B	Before	
work, pumped	8 BO & 35 BW in	n 24 hours. Wor	k performed 5-20-80.			
				- 12.72 to	7. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1.	
				July 5	1830	

