

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other

2. NAME OF OPERATOR
K M Production Co.

3. ADDRESS OF OPERATOR
P.O. Box 2406 Farmington, New Mexico 87401

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 790 FNL & 1730 FEL
AT TOP PROD. INTERVAL: same
AT TOTAL DEPTH: same

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA


REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other) Completion Operations

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☐
☐
☐

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

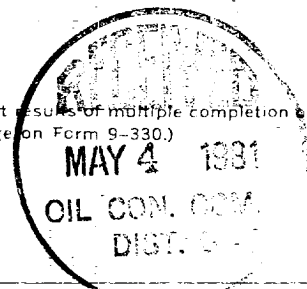

5. LEASE
NM-13381

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME
Bench

9. WELL NO.
1

10. FIELD OR WILDCAT NAME
Wildcat

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 34, T25N, R13W

12. COUNTY OR PARISH
San Juan

13. STATE
New Mexico

14. API NO.
None available

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6267 GL

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

- 4-21-81 Move in and rig up B & H Service Completion Rig. Swab well down to 1087'. Rig up Blue Jet. Run GR-CLL from PBTD of 1087' to surface. Perforate 1059-1061 with 2 1/8" formed wire glass tornado jet charges with 2 JSPF. Swab back water. No gas shows. Rig up Western. Acidized Pictured Cliff zone with 250 gals 15% HCL acid. Swab back load fluid. No gas shows. SDFN.
- 4-22-81 Overnight shut-in pressure was too small to measure. Swab back water. No gas shows. Rig up Blue Jet. Perforate 951-954, 3'; 957-959, 2'; and 962-967, 5', (total 10') with 2 1/8" formed wire glass tornado jet charges with 2 JSPF. Rig up Western. Acidize upper Pictured Cliffs zone with 250 gal. of 15% HCL acid. Swab back load fluid. No gas shows.
- 4-23-81 Overnight shut-in pressure was too small to measure. Release rig.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Kevin H. McLeod TITLE Managing Partner DATE 4/28/81

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
REASONS OF APPROVAL IF ANY:

ACCEPTED FOR RECORD

APR 30 1981

*See Instructions on Reverse Side

NMOCC

BY [Signature]
FARMINGTON DISTRICT