## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

		Sundry Noti	ces and Reports on	Wells	ro e e		
				<u> </u>	5.	Lease Number	
				gym i transf		SF-078124	
_	c **-33				6.	If Indian, Al	l. or
_	e of Well			25 27 28 30		Tribe Name	
	GAS		K	My COLLEGE DE			
					7.	Unit Agreemen	t Nam
Man	ne of Oper	ator	1	FEB 2000	7°-7	Huerfano Unit	
			& GAS COMPANY	RECEIVED	(J)		
-E	ESOT	NGTON RCES OIL	a de domine	OIL CON. DIV	্ৰে		
1	LOC	OIL	& GAS COMPANY	DIST. 3	ു 8	Well Name & N	umber
						Huerfano Unit	
Add	dress & Ph	one No. of Opera	07400 (505) 326-	360	<b>)</b> 9.	API Well No.	
PC	O Box 4289	, Farmington, NM	87499 (505) 326 <b>-</b> 3	STATE OF THE STATE	,	30-045-29168	
			og T P M		10.	Field and Poo	1
Loc	cation of	Well, Footage, S	ec., 1, k, m T-25-N, R-10-W, NME	PM		Basin Dakota	
145	50'FNL, 1	/20 FEL, Sec.10,	1 20 11, 10 10 11, 1111		11.	County and St	ate
						San Juan Co,	NM
	HECK ADDR	OPPIATE BOX TO IN	DICATE NATURE OF NO	TICE, REPORT	, OTHER	DATA	
	pe of Sub		Type	f Action			
TAI		ice of Intent	X Abandonment	Chang	ge of Pl		
	NOC.	ice of income	Recompletion	New	Construc	tion	
	Sub	sequent Report	Plugging Back	Non-F	Routine	Fracturing	
		bequest map and	Casing Repair	. Water	: Shut o	ff	
	X Fin	al Abandonment	Altering Cas	ing Conve	ersion t	o Injection	
	_^	Q1 110 011 01 01 01 01 01 01 01 01 01 01	X Other -	-			
3.	Describe	Proposed or Comp	oleted Operations				
-		_					
	2-2-00	MIRU. TOOH w/pum	np & rods. SDON.				
	2-3-00	ND WH. NU BOP. 7	TOOH w/2 7/8" tbg.	RU W/L. TIH	w/CIBP,	set @ 6412'. S	DON.
	2-4-00	DT CIPB to 500 r	osi OK Plug #1: p	ump 12 sx Cla	ass "B"	neat cmt insid	ie cso
		@ 6412-62501	Plua #2. nump 12 s	x Class "B" :	neat cmt	: inside csg w	34/4-
		5212/ Dlug #1	3. numn 13 sx Class	"B" neat cm	t inside	e csg @ 3545-33	. 69
		Dlug #4. numn	29 sx Class "B" ne	at cmt insid	e csg @	1990-1298, br	.ug #:
		Dump 23 gx Cla	ass "B" neat cmt in	side csg @ 1	213-902′	. Plug #6: pun	mp 12
		Fump 25 bit Car	t inside csq @ 416-	244'. SD for	weekend	1.	
		Class "R" neat					
	2-7-00	Class "B" neat	50'. Plug #7: pump	85 sx Class	"B" neat	cmt w/2% calc	cium
	2-7-00	Class "B" near	50'. Plug #7: pump	85 sx Class ace. WOC. ND	"B" neat BOP. Cu	cmt w/2% calc it off WH. Inst	-dll
	2-7-00	Class "B" near	50'. Plug #7: pump	85 sx Class ace. WOC. ND	"B" neat BOP. Cu	cmt w/2% calc it off WH. Inst	-dll
	2-7-00	Class "B" near	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B	85 sx Class ace. WOC. ND	"B" neat BOP. Cu	cmt w/2% calc it off WH. Inst	-dll
	2-7-00	Class "B" nead Perf 3 holes @ S chloride. Circ dry hole mark	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B	85 sx Class ace. WOC. ND	"B" neat BOP. Cu	cmt w/2% calc it off WH. Inst	-dll
	2-7-00	Class "B" nead Perf 3 holes @ S chloride. Circ dry hole mark	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B	85 sx Class ace. WOC. ND	"B" neat BOP. Cu	cmt w/2% calc it off WH. Inst	-dll
		Class "B" near Perf 3 holes @ ! chloride. Circ dry hole marke Morris, BLM, e	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B on LOC.)	85 sx Class ace. WOC. ND " neat cmt.	"B" neat BOP. Cu RD. Rig	cmt w/2% calc it off WH. Inst	-dll
.4.		Class "B" near Perf 3 holes @ ! chloride. Circ dry hole marke Morris, BLM, e	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B on LOC.)	85 sx Class ace. WOC. ND " neat cmt.	"B" neat BOP. Cu RD. Rig	cmt w/2% calc it off WH. Inst	-dll
.4.	I hereby	Class "B" near Perf 3 holes @ ! chloride. Circ dry hole mark Morris, BLM, o	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B on LOC.)  e foregoing is true	85 sx Class ace. WOC. ND " neat cmt.  and correct	"B" neat BOP. Cu RD. Rig	cmt w/2% calc it off WH. Inst released. (Jin	-dll
	I hereby	Class "B" near Perf 3 holes @ ! chloride. Circ dry hole mark Morris, BLM, o	50'. Plug #7: pump c 1 bbl cmt to surf er w/15 sx Class "B on LOC.)  e foregoing is true	85 sx Class ace. WOC. ND " neat cmt.  and correct	"B" neat BOP. Cu RD. Rig	cmt w/2% calc it off WH. Inst released. (Jin	-dll
igne	I hereby	Class "B" near Perf 3 holes @ ! chloride. Circ dry hole mark Morris, BLM,	50'. Plug #7: pump c 1 bbl cmt to surfer w/15 sx Class "B on LOC.)  e foregoing is true	85 sx Class ace. WOC. ND " neat cmt.  and correct	"B" neat BOP. Cu RD. Rig  ator_Da	te 2/17/00TLW	nmy
Signe	I hereby	Class "B" near Perf 3 holes @ ! chloride. Circ dry hole mark Morris, BLM,	50'. Plug #7: pump c 1 bbl cmt to surfer w/15 sx Class "B on LOC.)  e foregoing is true	85 sx Class ace. WOC. ND " neat cmt.  and correct	"B" neat BOP. Cu RD. Rig  ator_Da	te 2/17/00TLW	nmy
igne This	I hereby	Class "B" near Perf 3 holes @ ! chloride. Circ dry hole mark Morris, BLM, o	50'. Plug #7: pump c 1 bbl cmt to surfer w/15 sx Class "B on LOC.)  e foregoing is true	85 sx Class ace. WOC. ND " neat cmt.  and correct	"B" neat BOP. Cu RD. Rig  ator_Da	cmt w/2% calc it off WH. Inst released. (Jin	nmy