## State of New Mexico Energy, Minerals and Natural Resources Department OIL CONSERVATION DIVISION

2. Name of Operator Meridian Oil Inc 3. Address of Operat PO Box 4289, Farmington, NM 87499 3. Well Location 890'S, 1550'E Sec.30, Sec							
1. Type of Well GAS  2. Name of Operator Meridian Oil Inc 3. Address of Operat PO Box 4289, Farmington, NM 87499  3. Well Location 890'S, 1550'E Sec.30, 100 Mell Sec. 100 Mell Sec. 100 Mell No. 890'S, 1550'E Sec.30, 100 Mell Sec. 100 Mell No. 890'S, 1550'E Sec.30, 100 Mell Sec. 100 Mell No. 890'S, 1550'E Sec.30, 100 Mell No. 890'S, 10		Sundry N	otices and	Reports on	ells		
Meridian oil Inc  3. Address of Operal PO Box 4289, Farmington, NM 87499  4. Well Location 890'S, 1550'E Sec.30, 150'E Sec.30,		P	$B \perp D$	3045		_	
Meridian oil Inc  3. Address of Operal PO Box 4289, Farmington, NM 87499  4. Well Location 890'S, 1550'E Sec.30, 150'E Sec.30,	1. Type of	Well -	Temp		j.Type of L	ease	
Meridian Oil Inc  3. Address of Operal PO Box 4289, Farmington, NM 87499  4. Well Location 890'S, 1550'E Sec.30, 155-8, 6 -W  MELL CONS. DIV  10. Elevations 6388 'GR  Oil CON. DIV  11. Intent to/Subsequent Report of Displayback to Fruitland Coal  12. Describe proposed or completed operations: 07-21-90 MOL&RU. Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000#. Ran TDT, GR & CCL 2080-3045'. SDF weekend. 07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2983-92', 2998-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5% HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN. 07-24-90 Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN. 07-25-90 Flowed. Swabbed down. SDFN. 07-26-90 Swabbed. SDFN. 07-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement. 07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday. 07-30-90 Unload hole. CO to PBTD. SDFN. 07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 08-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE Regulatory Affairs  P-6-90 Date		GAS		1 A C	5.State Oil	& Gas Lease #	
3. Address of Operal PO Box 4289, Farmington, NM 87499  4. Well Location 890'S, 1550'E Sec.30, 1550'E Sec.30'E Sec.30, 1550'E Sec.30'E Sec.30	2. Name of	Operator $+$	1 P9 N9 0,	ned PC	Fee		
PO Box 4289, Farmington, NM 87499  1. Well Location 890'S, 1550'E Sec.30, 1550' Sec.30, 150					7 T No-	o/Writ Nome	
8. Well Location 890'S, 1550'E Sec.30, 150'E Sec	3. Address	of Operat	NM 87490				
890'S, 1550'E Sec.30,	4. Well Lo	cation	, NH 07433	,		2, 0 0	
10.Elevations 6388 'GR  O'L CON. D'V  11.Intent to/Subsequent Report of D'SFL\(\text{i}\)gback to Fruitland Coal  12.Describe proposed or completed operations: 07-21-90 MOL\(\text{RU}\). Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000\(\text{#}\). Ran TDT, GR & CCL 2080-3045'. SDF weekend. 07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2975-77', 2983-92', 2998-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5\(\text{*}\) HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN. 07-24-90 Frac w/2119 gal. x-link gel, 16,800\(\text{#}\) 40/70 sand and 111,540\(\text{#}\) 20/40 sand. SI 3 hrs. Flow back. SDFN. 07-25-90 Flowed. Swabbed down. SDFN. 07-26-90 Swabbed. SDFN. 07-27-90 Press.tbg to 700\(\text{#}\), opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800\(\text{#}\), no movement. 07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday. Unload hole. CO to PBTD. SDFN. 07-30-90 Unload hole. CO to PBTD. SDFN. 07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 08-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.	890'S,	1550'E	_	• • • •	·	3	
11.Intent to/Subsequent Report of SFLügback to Fruitland Coal  12.Describe proposed or completed operations: 07-21-90 MOL&RU. Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000 & Ran TDT, GR & CCL 2080-3045'. SDF weekend. 07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2975-77', 2983-92', 2998-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5% HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN. 07-24-90 Frac w/2119 gal. x-link gel, 16,800 & 40/70 sand and 111,540 & 20/40 sand. SI 3 hrs. Flow back. SDFN. 07-25-90 Flowed. Swabbed down. SDFN. 07-27-90 Press.tbg to 700 , opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800 , no movement. 07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday. 07-30-90 Unload hole. CO to PBTD. SDFN. 07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 08-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.	Sec.30,	Table No. 10 - W		IAE	9.Pool Name		
11.Intent to/Subsequent Report of Deployable to Fruitland Coal  12.Describe proposed or completed operations: 07-21-90 MOL&RU. Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000#. Ran TDT, GR & CCL 2080-3045'. SDF weekend. 07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2975-77', 2983-92', 2988-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5% HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN. 07-24-90 Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN. 07-25-90 Flowed. Swabbed down. SDFN. 07-26-90 Swabbed. SDFN. 07-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement. 07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday. 07-30-90 Unload hole. CO to PBTD. SDFN. 07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 07-31-90 TH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. 08-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.	10.Elevati	ons	AUG2 (	0 1990			
12.Describe proposed or completed operations:  12.Describe proposed or completed operations:  07-21-90 MOL&RU. Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000#. Ran TDT, GR & CCL 2080-3045'. SDF weekend.  07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2975-77', 2983-92', 2998-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5% HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN.  07-24-90 Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN.  07-25-90 Flowed. Swabbed down. SDFN.  07-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Full up 6 stds. SD for Sunday.  07-30-90 Unload hole. CO to PBTD. SDFN.  07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  08-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.	6388	'GR	OIL CO	N. DIV			
07-21-90 MOL&RU. Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000#. Ran TDT, GR & CCL 2080-3045'. SDF weekend.  07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2975-77', 2983-92', 2998-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5% HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN.  07-24-90 Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN.  07-25-90 Flowed. Swabbed down. SDFN.  07-26-90 Swabbed. SDFN.  07-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  07-30-90 Unload hole. Co to PBTD. SDFN.  07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  00 to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE Regulatory Affairs  Page for State USE)	11.Intent	to/Subsequent Re			Fruitland Co	al	
07-21-90 MOL&RU. Kill well w/wtr. ND WH. NU BOP. TIH w/tbg & scraper to 3100'. Ran CCL. Set CIBP @ 3045'. Load hole & PT 4000#. Ran TDT, GR & CCL 2080-3045'. SDF weekend.  07-23-90 Swabbed. Perf'd 2952-58', 2960-69', 2971-72', 2975-77', 2983-92', 2998-3005'. TIH w/tbg & 2 7/8" pkr & BP. BD w/7.5% HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN.  07-24-90 Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN.  07-25-90 Flowed. Swabbed down. SDFN.  07-26-90 Swabbed. SDFN.  07-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  07-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  07-30-90 Unload hole. Co to PBTD. SDFN.  07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  00 to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE Regulatory Affairs  Page for State USE)	12.Describ	e proposed or co	mpleted ope	erations:			
HCl. TOOH w/tbg, pkr & BP. Swabbed. SDFN. Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN. Flowed. Swabbed down. SDFN. Flowed. Swabbed. SDFN. Plowed. Swabbed. SDFN. Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement. TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  O7-30-90 Unload hole. CO to PBTD. SDFN.  O7-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. O8-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE Regulatory Affairs Pate Pate Pate Pate Pate Pate Pate Pate		3100'. Ran CCL. TDT, GR & CCL 2 Swabbed. Perf'	Set CIBP 080-3045'. d 2952-58'.	@ 3045'. Lo. SDF weekend . 2960-69',	ad hole & PT 2971-72', 29	4000#. Ran 75-77',	
Frac w/2119 gal. x-link gel, 16,800# 40/70 sand and 111,540# 20/40 sand. SI 3 hrs. Flow back. SDFN.  7-25-90 Flowed. Swabbed down. SDFN.  7-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  7-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  7-30-90 Unload hole. CO to PBTD. SDFN.  7-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  8-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE Regulatory Affairs  P-6-90 Date		2983-92', 2998-3005'. TIH w/tbg & 2 //8" pkr & BP. BD w//.3*					
20/40 sand. SI 3 hrs. Flow back. SDFN.  Flowed. Swabbed down. SDFN.  Swabbed. SDFN.  Press.tbg to 700#, opened valve to surge, no movement on swab.  Pressured & surged until pumping tee failed. Cut swab line,  remove & install new tee. Made 2 attempts @ 1800#, no movement.  TIH, tag sand 32' above cups. Washed sand out, released cups.  Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  07-30-90 Unload hole. CO to PBTD. SDFN.  07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE  SIGNATURE  Regulatory Affairs  P-6-90  Date	07-24-90	Frac $w/2119$ gal. x-link gel, 16,800# 40/70 sand and 111,540#					
Swabbed. SDFN.  O7-27-90 Press.tbg to 700#, opened valve to surge, no movement on swab. Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  O7-28-90 TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  O7-30-90 Unload hole. Co to PBTD. SDFN. O7-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE And		20/40 sand. SI 3 hrs. Flow back. SDFN.					
Press.tbg to 700#, opened valve to surge, no movement on swab.  Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  Unload hole. CO to PBTD. SDFN.  TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE  Regulatory Affairs  P-6-90 Date  This space for State use)							
Pressured & surged until pumping tee failed. Cut swab line, remove & install new tee. Made 2 attempts @ 1800#, no movement.  TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  Unload hole. CO to PBTD. SDFN.  TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE  Regulatory Affairs  P-6-90  Date							
TIH, tag sand 32' above cups. Washed sand out, released cups.  Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6 stds. SD for Sunday.  07-30-90 Unload hole. CO to PBTD. SDFN.  07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE SIGNATURE Regulatory Affairs Date	0, 2, 30	Pressured & surged until pumping tee failed. Cut swab line,					
Unload hole. CO to PBTD. SDFN.  07-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.  08-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE  SIGNATURE  Regulatory Affairs  Date  This space for State use)	07-28-90	TIH, tag sand 32' above cups. Washed sand out, released cups. Stripped out of hole, making cable cut at each connection. TIH open ended w/tbg, tag fill @ 2940'. Cleared tbg. Pull up 6					
O7-31-90 TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns. O8-01-90 CO to PBTD. Landed 91 jts 1 1/4", IJ tbg @ 3012' w/SN @ one jt off btm. ND BOP. NU WH. Released rig.  SIGNATURE SIGNATURE Regulatory Affairs Date	07-30-90			SDFN.			
off btm. ND BOP. NU WH. Released rig.  SIGNATURE Many Many Many Regulatory Affairs  Date  This space for State use)		TIH, tag fill. Unload hole. Flow 2 hr. SI 1 hr patterns.					
Date	08-01-90	CO to PBTD. Lan off btm. ND BO	ded 91 jts P. NU WH. F	1 1/4", IJ Released rig	tbg @ 3012' •	w/SN @ one jt	
Date							
Date		Man Stan	1 .1 .1	Pogulatory	Affaire	8-6-90	
(This space for State use)  Approximptor Description Signed by FRANK T. CHAVEZ  TITLE SUPERVISOR DISTRICT # 3  DATE  DATE	SIGNATURE	flygg Drugg	auca	_ Regulatory	Allairs _	Date	
(This space for State use)  PROPONED BY Original Signed by FRANK T. CHAVEZ  TITLE UPERVISOR DISTRICT # 3  DATE  DATE							
(This space for State use)  Approximp by Original Signed by FRANK T. CHAVEZ  TITLE SUPERVISOR DISTRICT # 3  DATE  AUG 2 2 190			,				
ADDROVED BY Original Signed by FRANK T. CHAVEZ TITTLE UPERVISOR DISTRICT TO DATE					oon nictaiet # 4	AUG 9 9 100	
APPROVED BI	APPROVED F	Original Signed by FRAN	K T. CHAVEZ	_ TITLEUPERVI	20K DI21KIC1 # 2	DATE AUU & & 133	

CONDITION OF APPROVAL, IF ANY: