

## Rincon Unit No. 122

### Plugging and Abandonment Procedure

1. Move in and rig up service unit. ND wellhead; NU BOPs.
2. TOH with 1 1/4" tubing, laying down.
3. TIH with tubing and retainer. Set retainer at 3150'.
4. Squeeze Pictured Cliffs with 50 sx of Class B cement containing 2%  $\text{CaCl}_2$ .  
Sting out of retainer. Cap retainer with 5 sx of cement.
5. Pressure test casing to 500 psi. Isolate any casing leaks. Squeeze any leaks with 20 sx of Class B containing 2%  $\text{CaCl}_2$ .
6. Place the following cement plugs with 15 sx each of Class B containing 2%  $\text{CaCl}_2$ :

Fruitland:	2950'-3050'
Kirtland:	2700'-2800'
Ojo Alamo:	2600'-2700'
Surface:	0' - 200'

Space out plugs using 9 ppg mud.

7. Cut off casing and erect dry hole marker.
8. Reclaim location as required.