## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

	F LAND MANAGEMENT		
Sundry Noti	ces and Reports on Well		
		0 FM 2: 31 <sub>5</sub> .	Lease Number SF- 079393
1. Type of Well GAS	₩.J.;ya	·	If Indian, All. or Tribe Name
2. Name of Operator		7.	Unit Agreement Name San Juan 27-5 Unit NP
BURLINGTON RESOURCES OIL &	GAS COMPANY		
		8.	Well Name & Number
3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700		9.	San Juan 27-5 Unit NP#84  API Well No.  30-039-07157
4. Location of Well, Footage, Sec., T, R, M		10.	Field and Pool
790'FSL 1825'FWL, Sec. 3, T-27-N, R-5-W, NMPM		11.	Basin Dakota County and State Rio Arriba Co, NM
12. CHECK APPROPRIATE BOX TO IND			DATA
Type of Submission Type of Action _X_ Notice of Intent Abandonment Change of Plans			
_X_ Notice of Intent	Abandonment Recompletion	Change of PI New Construc	tion
Subsequent Report	Plugging Back Non-Routine Fracturing		Fracturing
<del></del>	Casing Repair	_ Water Shut o	ff
Final Abandonment	Altering Casing _X_ Other - tubing rep	_ Conversion t	o Injection
13. Describe Proposed or Compl	eted Operations		····
It is intended to repair to attached procedure.	<del>-</del>	t well, accord	ing to the
	<u> </u>	DEGENY N Jul 2 0 20	
	(8	NEGENY N JUL 20 19 NIL GONG E DIGES E	MIN.
14. I hereby certify that the Signed My Stathuld (		orrect.	
			TLW
(This space for Federal or State APPROVED BY /S/ Duane W. Spencer CONDITION OF APPROVAL, if any:	Office use)Title	Date UL_	17 1998

## San Juan 27-5 Unit NP # 84

Basin Dakota 790'S, 1825'W

Unit N, Section 03, T-27-N, R-05-W Latitude / Longitude: 36° 35.85' / 107° 20.89'

DPNO: 50703A

Tubing Repair Procedure

- 1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
- 2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- Dakota, 2 3/8", 4.7#, J-55 tubing is set at 7831'. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) PBTD should be at +/- 7883'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
- 4. If fill, TIH with 3-7/8" bit and bit sub on 2-3/8" tubing (contact Operations Engineer if casing scraper is needed) and round trip to below perforations, cleaning out with air/mist. NOTE: When using air/mist, minimum mist rate is 12 bph. If scale is present, TIH with mill through perforations. TOOH with mill.
- 5. TOOH with 2-3/8" tubing. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom then ½ of the 2-3/8" production tubing. Run a broach on sandline to insure that the tubing is clear. TIH with remaining 2-3/8" tubing and then broach this tubing. Replace any bad joints. CO to PBTD with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary.

6. Land tubing at 7750'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. Obtain pitot gauge up the tubing. If well will not flow on it's own, make swab run to SN. RD and MOL. Return well to production.

Recommended: M.

Operations Engineer

Approved:

Bruco () Boy 1 5-25-49 Drilling Superintendent

Mike Haddenham

Office - (326-9577)

Home - (326-3102)

Pager - (327-8427)

Production Foreman - Lary Byars

Office - (326-9865)

Pager - (326-8909)