## UNITED STATES

## DEPARTMENT OF THE INTERIOR RUREAU OF LAND MANAGEMENT

Sundry Notices and Reports on Wells 2: 42	
Vicinity of the	5. Lease Number SF-080401A 0 79491 #
. Type of Well GAS	6. If Indian, All. or Tribe Name
E 11 10 12 12 13	Unit Agreement Name
. Name of Operator  JUN 2000	
Name of Operator  BURLINGTON  OIL & GAS COMPANY  PECEIVED  OIL CON  OIL CON	· · · · · · · · · · · · · · · · · · ·
. Address & Phone No. of Operator	8. Well Name & Number San Juan 27-5 U #17:
PO Box 4289, Farmington, NM 87499 (505) 326-9709	API Well No. 30-039-20678
. Location of Well, Footage, Sec., T, R, M	10. Field and Pool
1040'FSL, 1150'FWL, Sec.10, T-27-N, R-5-W, NMPM	Tapacito Pict. Cliff 11. County and State
	Rio Arriba Co, NM
2. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, C	OTHER DATA
Type of Submission Type of Action	
Notice of Intent _X_ Abandonment Change of Recompletion New Cons	
<del></del>	tine Fracturing
Casing Repair Water St	_
	iac off
Final Abandonment Altering Casing Conversion Other -	
Final Abandonment Altering Casing Conversi	
Final Abandonment Altering Casing Conversion Other -  Other -  Other -  Generations  6-1-00 MIRU. SDON.	ion to Injection
Final Abandonment Altering Casing Conversion Other -  3. Describe Proposed or Completed Operations  6-1-00 MIRU. SDON. 6-2-00 ND WH. NU BOP. TIH w/2 1/4" gauge ring to 4140'. TOOH. TI 4115'. TOOH. TIH, tag CIBP @ 4115'. Load hole w/12 bb failed. Plug #1: pump 22 sx Class "B" neat cmt w/2% c @ 3317-4115'. TOOH. WOC. TIH, tag Plug #1 @ 3435'. TO PT csg to 500 psi, failed. TIH, perf 2 sqz holes @ 22 TIH w/cmt retainer, set @ 2191'. TOOH. TIH. SD for we	ion to Injection  H w/2 7/8" CIBP, set @  l wtr. PT csg to 500 psi,  calcium chloride inside csg  OOH. Load hole w/7 bbl wtr.  258'. TOOH. Establish injecti
Final Abandonment Altering Casing Conversion Other -  Other -  3. Describe Proposed or Completed Operations  6-1-00 MIRU. SDON. 6-2-00 ND WH. NU BOP. TIH w/2 1/4" gauge ring to 4140'. TOOH. TI 4115'. TOOH. TIH, tag CIBP @ 4115'. Load hole w/12 bb failed. Plug #1: pump 22 sx Class "B" neat cmt w/2% c @ 3317-4115'. TOOH. WOC. TIH, tag Plug #1 @ 3435'. TO PT csg to 500 psi, failed. TIH, perf 2 sqz holes @ 22	ion to Injection  H w/2 7/8" CIBP, set @ ol wtr. PT csg to 500 psi, calcium chloride inside csg ooH. Load hole w/7 bbl wtr. 58'. TOOH. Establish injecti cekend. (Joe Ruybalid, BLM on oblish injection. Plug #2: pu ner @ 2208-2258'. Pump 3 sx 082-2191'. TOOH. TIH, perf 2 out bradenhead w/13 bbl wtr ceg & bradenhead. Circ 1 bbl ceg ce marker w/8 sx Class "B" nea
Other -  Oth	ion to Injection  H w/2 7/8" CIBP, set @ ol wtr. PT csg to 500 psi, calcium chloride inside csg ooH. Load hole w/7 bbl wtr. 58'. TOOH. Establish injecti cekend. (Joe Ruybalid, BLM on oblish injection. Plug #2: pu ner @ 2208-2258'. Pump 3 sx 082-2191'. TOOH. TIH, perf 2 out bradenhead w/13 bbl wtr ceg & bradenhead. Circ 1 bbl ceg ce marker w/8 sx Class "B" nea
Tinal Abandonment  Altering Casing Other -  Other -  Other -  Other -  Other -  Other -  Altering Casing Other -  Other -  Other -  Other -  Altering Casing Other -  Other -  Other -  Altering Casing Other -  Other -  Other -  Other -  Other -  Altering Casing Other -  Oth	ion to Injection  H w/2 7/8" CIBP, set @ ol wtr. PT csg to 500 psi, calcium chloride inside csg OH. Load hole w/7 bbl wtr. cekend. (Joe Ruybalid, BLM on oblish injection. Plug #2: pu ner @ 2208-2258'. Pump 3 sx O82-2191'. TOOH. TIH, perf 2 out bradenhead w/13 bbl wtr ceg & bradenhead. Circ 1 bbl ce ce marker w/8 sx Class "B" nead. Well plugged and abandoned
Altering Casing Conversion	The w/2 7/8" CIBP, set @ oll wtr. PT csg to 500 psi, realcium chloride inside csg not. Load hole w/7 bbl wtr. 158'. TOOH. Establish injective ekend. (Joe Ruybalid, BLM on ablish injection. Plug #2: puter @ 2208-2258'. Pump 3 sx 182-2191'. TOOH. TIH, perf 2 out bradenhead w/13 bbl wtresg & bradenhead. Circ 1 bbl ce marker w/8 sx Class "B" nead n. Well plugged and abandoned Date 6/13/00
Altering Casing Conversion	H w/2 7/8" CIBP, set @ ol wtr. PT csg to 500 psi, calcium chloride inside csg OH. Load hole w/7 bbl wtr. Es8'. TOOH. Establish injecticekend. (Joe Ruybalid, BLM on oblish injection. Plug #2: puter @ 2208-2258'. Pump 3 sx O82-2191'. TOOH. TIH, perf 2 out bradenhead w/13 bbl wtr or & bradenhead. Circ 1 bbl or or marker w/8 sx Class "B" nea or well plugged and abandoned
Altering Casing Conversion Other -  Oth	H w/2 7/8" CIBP, set @ ol wtr. PT csg to 500 psi, calcium chloride inside csg OH. Load hole w/7 bbl wtr. Es8'. TOOH. Establish injecticekend. (Joe Ruybalid, BLM on oblish injection. Plug #2: puter @ 2208-2258'. Pump 3 sx O82-2191'. TOOH. TIH, perf 2 out bradenhead w/13 bbl wtr or & bradenhead. Circ 1 bbl or or marker w/8 sx Class "B" nea or well plugged and abandoned