Submit 3 Copies to Appropriate District Office

## State of New Mexico Energy, Mi

Form C-103

Minerals and Natural Resources Department	Revised 1-

DISTRICTI P.O. Box 1980, Hobbs, NM 88240 OIL CONSERVATION DIVISION P.O. Box 2088	WELL API NO. 30-039-24739
DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease
DISTRICT III	STATE FEE
1000 Rio Brazos Rd., Aztec, NM 87410	6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	7. Lease Name or Unit Agreement Name
l. Type of Well:	Johnston A
OE GAS WELL X OTHER	DOMESCON A
2. Name of Operator Union Oil Company of California	8. Well No.
3. Address of Operator	9. Pool name or Wildcat
P. O. Box 671 - Midland, TX 79702	Basin Fruitland Coal
4. Well Location	Basin Fluitiana Coal
Unit Letter A: 790 Feet From The north Line and 7	90 Feet From The east Line
Section 36 Township	NMPM Rio Arriba County
10. Elevation (Show whether DF, RKB, RT, GR, etc.,	
(/////////////////////////////////////	
<b>~</b>	Report or Other Data
11. Check Appropriate Box to Indicate Nature of Notice	o, Report, or Outer Data
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL	SUBSEQUENT REPORT OF:
NOTICE OF INTENTION TO:  SERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRIL	SUBSEQUENT REPORT OF:
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL  PULL OR ALTER CASING CASING TEST AN	SUBSEQUENT REPORT OF:  ALTERING CASING  LING OPNS.  PLUG AND ABANDONMENT
NOTICE OF INTENTION TO:  SERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL  TOTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates,	CUBSEQUENT REPORT OF:  ALTERING CASING  LING OPNS. X PLUG AND ABANDONMENT  D CEMENT JOB X
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL  PULL OR ALTER CASING CASING CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.	LING OPNS.   D CEMENT JOB   including estimated date of starting any proposed
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL  PULL OR ALTER CASING CASING CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all persinent details, and give persinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  P. RIH. NO FILL. LDDP. R&C 79
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILL  CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all persinent details, and give persinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  1. RIH. NO FILL. LDDP. R&C 79  3. a 3273', T/FC a 3227' & T/DV
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W(125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S	ALTERING CASING  LING OPNS. X PLUG AND ABANDONMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  6 a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0	ALTERING CASING  LING OPNS. X PLUG AND ABANDONMENT  D CEMENT JOB X  including estimated date of starting any proposed  1. RIH. NO FILL. LDDP. R&C 79  3. a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  1. RIH. NO FILL. LDDP. R&C 79  3. a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', HLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W(125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO	ALTERING CASING  LING OPNS. X PLUG AND ABANDONMENT  D CEMENT JOB X  including estimated date of starting any proposed  1. RIH. NO FILL. LDDP. R&C 79  3. a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL a 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC a 3227 W/50 BBLS MUD a 5.0  W/1000 PSI a 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT3/SK PERLITE + 5#/SK  MIXED a 12.0 PPG F/B 50 SX "B" NEAT MIXED a 15.6 PPG. PRECEDED CMT W/10 BW.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  1. RIH. NO FILL. LDDP. R&C 79  3. a 3273', T/FC a 3227' & T/DV  3. K HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  XX LY/SOU PSI. CIRC 6 HRS. CIRC  3. C HI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5
NOTICE OF INTENTION TO:  SERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  DIA Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W(125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W(428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  G a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT3/SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  SA 3273', T/FC & 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED & BPM & 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL & 2834' & 5  REL PR. NO BACKFLOW. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W(25) SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  G a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W(25) SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  G a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W(25) SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  G a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.  TRACE CMT TO SURF. ND BOP. SET SLIPS & CUT OFF 4-1/2" CSG. REL RIG @ 2:30	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  G a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC
NOTICE OF INTENTION TO:  SERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.  TRACE CMT TO SURF. ND BOP. SET SLIPS & CUT OFF 4-1/2" CSG. REL RIG @ 2:30	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  3 a 3273', T/FC a 3227' & T/DV  5K HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  5OL W/800 PSI. CIRC 6 HRS. CIRC  5 HI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC  AM 8-4-90.
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  OTHER:  OTHER:  OTHER:  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL @ 2834'. CMTD STA #1 W/125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC @ 3227 W/50 BBLS MUD @ 5.0  W/1000 PSI @ 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OP BOMB & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W/428 SX 65/35/5 + 1/2 FT <sub>3</sub> /SK PERLITE + 5#/SK  MIXED @ 12.0 PPG F/B 50 SX "B" NEAT MIXED @ 15.6 PPG. PRECEDED CMT W/10 BW.  BPM @ 650-800 PSI. PLUG DOWN & DV TOOL CLOSED @ 2500 PSI @ 12:25 AM 8-4-90.  TRACE CMT TO SURF. ND BOP. SET SLIPS & CUT OFF 4-1/2" CSG. REL RIG @ 2:30	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  O'. RIH. NO FILL. LDDP. R&C 79  B a 3273', T/FC a 3227' & T/DV  SK HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  DOL W/800 PSI. CIRC 6 HRS. CIRC  CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC  AM 8-4-90.
NOTICE OF INTENTION TO:  PERFORM REMEDIAL WORK  PLUG AND ABANDON  CHANGE PLANS  COMMENCE DRIL  CASING TEST AN  OTHER:  12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, work) SEE RULE 1103.  FIN RUN SCH. OH LOGS: FDC/HRL 3271-360', MLT 3252-2200' & COAL LOG 3271-2950  JTS + 1 PC (3260') 4-1/2" OD, 11.6# 8RD J55 & K55, LTC & STC, NEW EW CSG W/FS  TOOL & 2834'. CMTD STA #1 W(125 SX CL "H" + 3% KCL + .18% THRIFTYLITE + 3#/S  15.9 PPG. PRECEDED CMT W/50 BW. DISP PLUG TO FC & 3227 W/50 BBLS MUD & 5.0  W/1000 PSI & 5:50 PM 8-3-90. REL PR/NO BACKFLOW. DROPPED OB BLSM & OP DV TO  25 SX CMT TO SURF. CMTD STA #2 W(428 SX 65/35/5 + 1/2 FT 3/SK PERLITE + 5#/SK  MIXED & 12.0 PPG F/B 50 SX "B" NEAT MIXED & 15.6 PPG. PRECEDED CMT W/10 BW.  BPM & 650-800 PSI. PLUG DOWN & DV TOOL CLOSED & 2500 PSI & 12:25 AM 8-4-90.  TRACE CMT TO SURF. ND BOP. SET SLIPS & CUT OFF 4-1/2" CSG. REL RIG & 2:30  I hereby certify that the information above us true and complete to the best of my knowledge and belief.	ALTERING CASING  LING OPNS. X PLUG AND ABANDONIMENT  D CEMENT JOB X  including estimated date of starting any proposed  1. RIH. NO FILL. LDDP. R&C 79  3. a 3273', T/FC a 3227' & T/DV  3K HI SEAL + 1.2% CF-14 MIXED a  BPM a 200-350 PSI. BUMPED PLUG  30L W/800 PSI. CIRC 6 HRS. CIRC  31. CHI SEAL + .08% CF-1 + 2% CACL2  DISP PLUG TO DV TOOL a 2834' a 5  REL PR. NO BACKFLOW. CIRC  AM 8-4-90.

APPROVED BY

Original Signed by FRANK T. CHAVEZ

THERYISOR DISTRICT ...

AUG 1 0 1990

- DATE -

CONDITIONS OF APPROVAL, IF ANY: