UNITED STATES

DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

~ .	- 0	- 1		·-·	r
- W 1	- C	- 1	M		ì
- 111		L. 1	¥	<u>.</u>	i

1. Type of Well GAS 7. Use Signal Of Farmington, NM6. If The Color of Well, Footage, Sec., T, R, M 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM 8. Signal Of Farmington, NM B A Signal Of	
1. Type of Well GAS 7. Un RESOURCES OIL & GAS COMPANY S. W. S.	
1. Type of Well GAS 7. University of Operator RESOURCES OIL & GAS COMPANY 8. William of Operator PO BOX 4289, Farmington, NM 87499 (505) 326-9700 4. Location of Well, Footage, Sec., T, R, M 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X Abandonment Change of Plans Recompletion New Constructic X Subsequent Report Plugging Back Non-Routine Fre Casing Repair Water Shut off Final Abandonment Conversion to 1 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU, ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Clas 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenh Install dry hole marker w/10 sx Class "B" neat cmt. RD.	ease Number F-079365
S. S. S. S. S. S. S. S.	f Indian, All. or ribe Name
BESOURCES OIL & GAS COMPANY 8. W 8. W 8. W 8. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700 9. A 4. Location of Well, Footage, Sec., T, R, M 10. F 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM B 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X Abandonment Recompletion New Construction Non-Routine Frame Casing Repair Casing Repair Water Shut off Final Abandonment Casing Repair Non-Routine Frame Casing Conversion to 100 other 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Clas 1270-1370'. TOOH. Establish circ down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" neat cmt. RD.	nit Agreement Name
8. W 3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700 9. A 4. Location of Well, Footage, Sec., T, R, M 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X Abandonment Recompletion New Construction X Subsequent Report Plugging Back Non-Routine Fra Casing Repair Water Shut off Final Abandonment Altering Casing Conversion to 1 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Clas 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	
8. W 3. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700 9. A 4. Location of Well, Footage, Sec., T, R, M 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X Abandonment Recompletion New Construction X Subsequent Report Plugging Back Non-Routine Fra Casing Repair Water Shut off Final Abandonment Altering Casing Conversion to 1 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Clas 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	
B. Address & Phone No. of Operator PO Box 4289, Farmington, NM 87499 (505) 326-9700 9. A 4. Location of Well, Footage, Sec., T, R, M 10. F 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X Abandonment Change of Plans Recompletion New Construction Recompletion Altering Casing Repair Water Shut off Conversion to 1 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plus "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pums cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Clas 1270-1370'. TOOH. Establish circ down csg & out bradenhead. Cir surface. WoC. ND BOP. Cut off WH. Pump 5 sx Class "B" reat cmt. RD.	an Juan 28-6 Unit
PO Box 4289, Farmington, NM 87499 (505) 326-9700 4. Location of Well, Footage, Sec., T, R, M 10. F 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM Type of Submission Notice of Intent X Abandonment Recompletion Non-Routine Fra Casing Repair Final Abandonment Altering Casing Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Clas 128 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" reat cmt. RD.	ell Name & Number
A. Location of Well, Footage, Sec., T, R, M 10. F 1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM (C) 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Type of Action Notice of Intent (C) (X) (X) (Subsequent Report (C) (C) (C) (C) (C) (E) (C) (E) (C) (E) (E	an Juan 28-6 U NP #4
1870'FNL, 1775'FEL, Sec.14, T-27-N, R-6-W, NMPM B 11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X Abandonment Recompletion New Construction Plugging Back Non-Routine Fra Casing Repair Water Shut off Final Abandonment Altering Casing Conversion to 100 Other 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Cla 1270-1370'. TOOH. Establish circ down csg & out bradenhead. Circ surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" reat cmt. RD.	PI Well No. 0-039-25159
11. C R 12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DAY Type of Submission Notice of Intent X_ Abandonment Change of Plans Recompletion New Construction Non-Routine Fraction Casing Repair Water Shut off Final Abandonment Altering Casing Conversion to 100 ther - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plus WB" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class 1270-1370'. TOOH. Establish circ down csg & out bradenhead. Circ surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" rest cmt. RD.	ield and Pool
Type of Submission Notice of Intent X Abandonment Recompletion Non-Routine Fra Casing Repair Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class 28 sx Class "B" neat cmt down csg & out bradenhead. Cin surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" reat cmt. RD.	asin Fruitland Coal
Type of Submission Notice of Intent	ounty and State io Arriba Co, NM
Type of Submission Notice of Intent Recompletion Recompletion New Construction New Construction Recompletion Non-Routine Fraging Back Casing Repair Conversion to 100 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Circ surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" Install dry hole marker w/10 sx Class "B" neat cmt. RD.	
Notice of Intent X Abandonment Change of Plans Recompletion New Construction X Subsequent Report Plugging Back Non-Routine France Casing Repair Water Shut off Casing Repair Conversion to Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class "B" neat cmt down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" Install dry hole marker w/10 sx Class "B" neat cmt. RD.	ATA
Recompletion New Construction X Subsequent Report Plugging Back Non-Routine France Casing Repair Water Shut off Casing Repair Conversion to 10 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plugwish neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class "B" neat cmt down csg & out bradening 28 sx Class "B" neat cmt down csg & out bradening surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" rest cmt. RD.	3
Z Subsequent Report Plugging Back Non-Routine Fra Casing Repair Water Shut off Altering Casing Conversion to 1 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Cla 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	on
Casing Repair Water Shut off Other	cturing
Final Abandonment Altering Casing Conversion to 1 Other - 13. Describe Proposed or Completed Operations 4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class "B" neat cmt down csg & out bradenhead. Cing surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" Install dry hole marker w/10 sx Class "B" neat cmt. RD.	
4-4-97 MIRU. ND WH. NU BOP. TOOH w/2 3/8" tbg. SD for weekend. 4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Cla 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	Injection
4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class "B" neat cmt down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" Install dry hole marker w/10 sx Class "B" neat cmt. RD.	
4-7-97 TIH w/gauge ring & CIBP. Set CIBP @ 3032'. TOOH. TIH. Plug "B" neat cmt @ 2890-3032'. TOOH to 2422'. Plug #2: pump cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Cla 1270-1370'. TOOH. Establish circ down csg & out bradenh 28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	
cmt @ 2422-2745'. TOOH w/1270'. Plug #3: pump 12 sx Class 1270-1370'. TOOH. Establish circ down csg & out bradenhead. Circ surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" restall dry hole marker w/10 sx Class "B" neat cmt. RD.	g #1: pump 15 sx Clas o 29 sx Class "B" nea
28 sx Class "B" neat cmt down csg & out bradenhead. Cir surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	ss "B" neat cmt @
surface. WOC. ND BOP. Cut off WH. Pump 5 sx Class "B" r Install dry hole marker w/10 sx Class "B" neat cmt. RD.	lead. Plug #4: pump
Install dry hole marker w/10 sx Class "B" neat cmt. RD.	c 1 bbl cmt to
	Pig released Well
prugged and abandoned 4-7-97.	Rig Tereasea. Merr
	to the property
Marlin Deaton, BLM on location for plugging.	
	ra i moji tipi I poja bila rboj
14. I hereby certify that the foregoing is true and correct.	· Aud
Signed figgy State huld Title Regulatory Administrator Date	4/30/97
(This space for Federal or State Office use)	AY - 5 1997
APPROVED BY STORY Title Date	31 W 67771