

submitted in lieu of Form 3160-5

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
Sundry Notices and Reports on Wells

1. Type of Well
Gas

2. Name of Operator
Robert L. Bayless

3. Address & Phone No. of Operator
P.O. Box 168, Farmington, NM 87499 (505)326-2659

Location of Well, Footage, Sec., T, R, M
790 FSL & 790 FWL, Sec 8, T26N, R18W

5. Lease Number
14-20-603-5033

6. If Indian, All. or
Tribe Name
Navajo

7. Unit Agreement Name

8. Well Name & Number
Navajo P #1

9. API Well No.
30-045-87066 05890

10. Field and Pool
Wildcat

11. County & State
San Juan County, NM

RECEIVED
JUN 21 1999
OIL CON. DIV.
DIST. 3

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment

Type of Action

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other -

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

Robert L. Bayless plugged and abandoned said well on 5-27-99 per attached P&A Report

14. I hereby certify that the foregoing is true and correct.

Signed Tom McCarthy Title Engineer Date 6/14/99

(This space for Federal or State Office use)

APPROVED BY _____ Title _____ Date _____

CONDITION OF APPROVAL, if any:

JUN 17 1999

FIELD OFFICE

A - PLUS WELL SERVICE, INC.

P.O. BOX 1979
FARMINGTON, NM 87499
505-325-2627 • FAX: 505-325-1211

Robert L. Bayless

Navajo Tribal "P" #1

790' FSL and 790' FWEL Sec. 8, T-26-N, R-18-W
San Juan County, NM
BIA 14-20-603-5033

June 1, 1999

Plug & Abandonment Report

Cementing Summary:

Plug #1 with CIBP at 885', spot 46 sxs inside 8-5/8" casing above CIBP to 733' to isolate Dakota perforations.

Plug #2 with 28 sxs Class B cement inside 8-5/8" casing from 62' to surface, circulate good cement out casing valve.

Plugging Summary:

Notified BLM on 5/26/99

5-26-99 Road rig to location, RU. TOH and LD 22 - 7/8" rods and 4-1/2" pump. SDFD.

5-27-99 Safety Meeting. Dig out wellhead and changeover for 4-1/2" casing. ND 4-1/2" x 8-5/8" swedge and LD 18 joints 4-1/2" casing. Changeover for 2-3/8" tubing. RU A-Plus wireline truck. TIH and set 8-5/8" Baker CIBP at 885'. NU 8-5/8" x 7" wellhead and BOP, test. RU tubing equipment. TIH with Bayless 2" tubing workstring and tag CIBP at 885'. Load casing with 3 bbls water and pressure test to 500# for 10 min, held OK. Plug #1 with CIBP at 885', spot 46 sxs Class B cement inside casing above CIBP to 733' to isolate Dakota perforations. TOH to 62' with tubing. Plug #2 with 28 sxs Class B cement inside 8-5/8" casing from 62' to surface, circulate good cement out casing valve. TOH and LD tubing. WOC. ND BOP and wellhead; found cement at surface. Mix 16 sxs Class B cement and install P&A marker. RD rig and equipment; move off location.
J. Ruybalid, BLM, and J. Bennett, Navajo Nation, were on location.

5-28-99 Safety Meeting. Road rig and equipment to A-Plus Yard.