Form 3160-5 (June 1990)

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

BUREA	Expires: March 31, 1993	
Do not use this form for prop	TICES AND REPORTS ON WELLS posals to drill or to deepen or reentry to a different reservoir. EATION FOR PERMIT - " for such proposals	E. Lease Designation and Serial No. NM-012201 S. If Indian, Allottee or Tribe Name
		7. If Unit or CA, Agreement Designation
1, Type of Well Oil Gas Well Other		8. Well Name and No.
2. Name of Operator	Attention:	BLANCO LS 19
AMOCO PRODUCTION COM		9. API Well No.
3. Address and Telephone No. P.O. Box 800, Denver, Colorado 80201 (303) 830-4912		3004520902
		10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or	Survey Description)	BLANCO PICT. CLIFFS SO.
		11. County or Parish, State
971 FNL 1747FWI	L Sec. 1 T 27N R 8W	San Juan New Mexico
12. CHECK APPROPR	IATE BOX(s) TO INDICATE NATURE OF NOT	ICE , REPORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF A	CTION
Notice of Intent Subsequent Report Final Abandonment Notice	Abandonment Recompletion Plugging Back Casing Repair Altering Casing Other	Change of Plans New Construction Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)
subsurface locations and measured and true	(Clearly state all pertinent details, and give pertinent dates, including estimated date is vertical depths for all markers and zones pertinent to this work.)* G AND ABANDON THIS WELL PER THE ATTACHED P	
	DECEN Jun 3 d 19 ON GON. D DIST. 3	0/ 14/ 2 =

06-16-1994 **BUSINESS ANALYST** Title Approved by . FPROVED Conditions of approval, if any: Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, ficticions, or representations as to any matter within its jurisdiction.

• See Instructions on Reverse Side

NMOCD

PXA Procedures Blanco LS #19

- MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
- 2. RIH with 1 1/4" workstring and cement retainer, set retainer at 3180'. Test casing integrity to 500#. Squeeze perfs at 3230' to 3250' with 8.633 cuft cement. Pull out of retainer and spot cement plug to 1930' with 60.93 cuft cement.
- 3. Run in hole with perf gun and shoot squeeze holes at 1900'. RIH with tbg and cement retainer, set retainer 50' above squeeze holes and attempt to circulate to surface with 148.50 cuft cement. Pull out of retainer and fill hole to surface with 92.625 cuft cement.
- NDBOP. Cut of casing and wellhead. Install PXA marker according to BLM or State requirements.
- 5. Turn over to John Schwartz for reclamation.
- 6. Rehabilitate location according to BLM or State requirements.

Location — 1C— 27N— 8W SINGLE pc Orig.Completion — 9/72 Last File Update — 1/89 by 803

