

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPlicate
(Other instructions on reverse side)Form approved
Budget Bureau No. 42 R1424.
PLEASE DESIGNATE AND SERIAL NO.

14-20-0603-8103

6. INDIAN, ALIEN OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT" for such proposals.)

Navajo Tribe

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Navajo Tribe "AR"

9. WELL NO.

7

10. FIELD AND FOOT, OR WILDCAT

Tocito Dome Penn "D"

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

S27, T26N, R18W

12. COUNTY OR PARISH

San Juan

13. STATE
New Mexico

310' from South line and 1980' from West line.

15. ELEVATIONS (Show whether DE, RT, GR, etc.)

5695' GL

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

TELL WATER TO OFF

PULL OR ALTER CASING

PUMP REPAIR

MULTIPLE COMPLETE

SHOOTING OR ALIEN

ABANDON*

REPAIR WELL

CHANGE PLANS

X

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ALIEN

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well Completion or Recombination Report and Log form.)

16. (If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to the work.)

TEXACO, Inc. proposes to plug and abandon this well because of collapsed casing on the production tubing. An attempt to run a rod pump failed. Tubing & casing are collapsed at 3125'. The well will be plugged as follows:

- 1) MIRUSU.
- 2) Cut 2-7/8" tbg. off above submersible pump check (6200' GL) with jet cutter.
- 3) Pump 45 sx class B neat cement down tubing to cover perforations.
- 4) Cut tubing off above collapse point (3125' GL) with jet cutter.
- 5) Fill hole with water.
- 6) Pump 30 sx class B neat cement down tubing to cover collapse area.
- 7) Pick tubing up 120'.
- 8) Displace cement with 3 bbls. water.
- 9) Pull tubing.
- 10) Set 30' surface plug in 7" casing. (7' sx cement)
- 11) Erect marker and clean location.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE Field Foreman

DATE 9-21-77

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

OCT 26 1977

TITLE

DATE

M. L. SEEINGER
ACTING DISTRICT ENGINEER

*See Instructions on Reverse Side

USGS (4) NMCC (2) GLE-ARM_JHP