F 2160 F			••		Form approved. Budget Bureau		
Form 3160-5 (November 198	33)	UNITED STATE TMENT OF THE		SUBMIT IN TRIPLICATE (Other instructions on r	Expires August 5. LEASE DESIGNATION	31, 1985	
(Formerly 9-3	, ==	EAU OF LAND MANA	-	(verse ande)	14-20-603-		
		OTICES AND REP		WELLC	6. IF INDIAN, ALLOTTE		
(Do not		DINCES AND REP Openals to drill or to deep CATION FOR PERMIT—					
ī	Use "APPL	Navajo					
OIL X	GAS OTHER				7. UNIT AGREEMENT NA	. b E	
2. NAME OF OPERATOR					8. FARM OR LEASE NAM	<u>Ω</u> k	
Texaco Inc.					Dome Old Tr	Dome Old Trading Post	
3. ADDRESS OF OPERATOR					9. WBLL NO.		
P.O. Box EE, Cortez, CO. 81321					3		
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface					10. FIELD AND POOL, OR WILDCAT		
At surrace		•		CIVED	Bisti - Lov	wer Gallup	
2310	FSL, 330'	FEL.	30	L 1 5 1985	SURVEY OR ARMA	M. W. 1	
	102, 330	1	BUREAU OF	LAND MANAGEMENT	Sec 9 #261	וא וו ס	
14. PERMIT NO.		15. ELEVATIONS (Show	whether se,	GRICE SURCE AREA	Sec. 9, T261	13. STATE	
		6051' (GR		San Juan	New Mexico	
16.	Check	Appropriate Box To I	ndicale Natu	re of Notice, Report, or	Other Data		
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:							
TEST WATE					PROGRAMMO A		
FRACTURE		MULTIPLE COMPLETE		WATER SHUT-OFF FRACTURE TREATMENT	ALTERING C		
BHOOT OR	ACIDIZE	ABANDON*	XX	SHOOTING OR ACIDIZING	ABANDONME		
REPAIR WE	LL	CHANGE PLANS		(Other)			
(Other)	Completion or Recompletion is					rra.)	
nent to th	nis work.) *	ectionally drined, give augi	driace locations	talls, and give pertinent date and measured and true vert	ical depths for all marker	and sones perti-	
Texac	o proposes	to plug and a	abandon	this well using	g the following	ng procedure	
subject to managerial approval. Approval of this procedure should require approximately 90 days. Texaco will advise your office before plugging							
opera	tions are	nitiated so	that a	advise your off representative	tice before p	lugging	
desir	e.	initiated, so	that a	representative	may be presen	it ir you so	
PROCE	EDURE:						
1.)							
2.)							
3.)	3.) Spot 25 sx class B neat cement on top of stuck RBP. Cement top above						
4.)	1629. Tag top if necessary. Load hole w/9.2 lb./gal. mud.						
						ent into	
	retainer to bring cement inside & outside of casing from 1960' to 113 Displace cement and clean out tubing using 9.2 lb./gal. mud.						
5.)	Spot 25 sx Class B cement from 275 KB to surface inside casing.						
6.)	.) Pump 60 sx class B cement down braidenhead to acheive cement plug						
	outside of	casing from 2	275 to s	urface. 🖊 🥕 🦠		- F5	
7.)	Erect marke	er and clean	location	•			

18. I hereby certify that the foregoing is true and correct

SIGNED APPROVED BY CONDITIONS OF APPROVAL, IF ANY:

BLM (b) - NMOGCC (3) - Navajo Tribe - JNH - AJS - ARM

*See Instructions on Reverse Side

NMOCCI