Form 3160-5 (June 1990)

I. Type of Well Oil Well

2. Name of Operator

3. Address and Telephone No.

Gas Well

Floyd Operating Company

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

## UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED				
Budget Bure	eau No.	10	04-0135	
Expires:	March	31.	1993	

5. Lease Designation and Serial No.

N00-C-14-20-7464 6. If Indian, Allottee or Tribe Name

Τ.

8. Well Name and No. Navajo "LB" #2

30-045-25987

10. Field and Pool, or Exploratory Area Bisti Farmington

9. API Weil No.

## SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

711 Louisiana, Suite 1740, Houston, Texas 77002

Navajo Alloted 7. If Unit or CA, Agreement Designation

1741' FSL and 1098' FWL Se	ec 33, T26N, RG12W	San Juan Co., New Mexico
12. CHECK APPROPRIATE BOX(	s) TO INDICATE NATURE OF NOTICE, REPOR	RT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION	
Notice of Intent  XX Subsequent Report  OCT 0 4  Final Abandonment Notice L CONDIST.	J. DIV. Altering Casing Other Oil CON DIV	Change of Plans  New Construction  Non-Routine Fracturing  Water Shut-Off  Conversion to Injection  Dispose Water  (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

Well Plugged and Abandoned September 14, 1993

give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

## Plugging Summary:

Drive rig and equipment to location. Rig up and spot equipment; lay relief line to pit. Open well up and bleed down. ND wellhead and NU BOP. POH and tally 18 joints 1-1/4" IJ tubing, 596'. Pumped into bradenhead valve and pressured up to 1500#. Procedure change approved by K. Schneider with BLMs not necessary to perforate. RIH with open ended tubing to 595' and pump 10 bbls water. Plug #1 from 595' to surface with 31 sxs Class B cement. Circulate good cement to surface. Pull tubing and LD. Shut in well and dig out casing head. Open well up and ND BOP. Cut off wellhead and fill casing with cement, then install P&A marker; total 25 sxs cement. Cut off anchors below ground level. Rig down and move off location.

## Cement Plugs:

Plug #1 - from 595' to surface with 31 sxs Class B cement, circulate good cement to surface.

14. I hereby certify that the foregoing is true and correct Signed	Title Manager of Production	Date 9/22/93
(This space for Federal or State office use)  Approved by Conditions of approval, if any:	Approved as to plugging of the well bore.  Liability under bond is retained until surface restorations is completed.	A PPROVED
Title 18 U.S.C. Section 1001, makes it a crime for any person lor representations as to any matter within its jurisdiction.	knowingly and willfully to make to any department or agency of the Unite	d States for black firstious or fraudulent statements
7	*Coo Instruction on Bourse Side	ייאט