

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

SF-078622

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

GREAT WESTERN DRILLING CO.

3. Address and Telephone No.

2550 La Plata Hwy, Farmington, NM 87401

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2165' FEL & 2195' FSL

Sec. 13, T-26N, R-8W

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Federal Bond #1-E

9. API Well No.

10. Field and Pool, or Exploratory Area

Blanco Mesa Verde

11. County or Parish, State

San Juan, New Mexico

12. CHECK APPROPRIATE BOXES TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9-3-91 Perf. PC 2149-2154, 2173-2183 15' 2 SPF 30 holes, Set RBP @ 2314'.

9-4-91 Acidize w/500 gal. 15% swab test.

9-5-91 Frac w/25,700# 20/40 Brady sand and 40,500 gal. slick water.

9-6-91 to 9-9-91 Swab & test PC

9-10-91 Pull RBP run tubing to 6510', set model "D" @ 6510' w/sliding sleeve 6' above model "D" + 1.78 profile top of model "D".

9-11-91 Swab off Dakota, set blanking plug on model "D", open sliding sleeve.

9-11 to 9-14-91 Swab casing dry, let PC dry up casing.

9-15-91 Close sliding sleeve, pull blanking plug out of model "D" shut well in for buildup.

ACCEPTED FOR RECORD
OCT 06 1991
FARMINGTON RESOURCE AREA

14. I hereby certify that the foregoing is true and correct

Signed

Title Drilling & Production Supervisor Date 9-24-91

(This space for Federal or State office use)

Approved by

Title

Date

Conditions of approval, if any: