

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved,
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.
Jicarilla Tribal Contr 241

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

Jicarilla Apache

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Boulder

9. WELL NO.

4

10. FIELD AND POOL, OR WILDCAT

Boulder Mancos

11. SEC., T., R., M., OR BLL. AND SURVEY OR AREA

Sec. 23, T28N, R1W

12. COUNTY OR PARISH 13. STATE

Rio Arriba

NM

SUNDRY NOTICES AND REPORTS ON WELLS
(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER WORKOVER

2. NAME OF OPERATOR
Tesoro Petroleum Corporation

3. ADDRESS OF OPERATOR
633 17th Street, Suite 2000, Denver, CO 80202

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.)
At surface

330' FNL; 1650' FWL

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, CR, etc.)

GL 7195'; KB 7206'

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐
☒

PULL OR ALTER CASING

☐
☐
☐
☐
☐

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

☐
☐
☐
☐
☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

It is proposed to place the Boulder Mancos #4 back on production by workover.

CURRENT CONDITION OF WELL: Hole collapsed between bottem of 7" OD casing @ 3041' GL and top of perforated 4 1/2" liner @ 3293' GL. This missing section of 4 1/2" OD liner was shot off and pulled during previous workover attempt in July, 1974.

WORKOVER PLAN: Move in cable tools and clean out old hole to the PBTD @ 3975' GL, sidetrack existing liner and run in a full 4 1/2" liner with lead seal from 2950' to PBTD of 3975' GL. Install pumping equipment, tubing, rods, etc., and return well to production.

NOTE: No additional surface disturbance is anticipated as a result of this workover.



18. I hereby certify that the foregoing is true and correct

SIGNED

William F. H. H.

TITLE Dist. Prod. Supt.

DATE 8-15-77

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

APPROVED

AUG 18 1977

E. A. SCHWIDT
ACTING DISTRICT ENGINEER

*See Instructions on Reverse Side