Form 3160-5 (Saune 1220)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT

CEVORRAN MROR

Budget Bureau No. 1004-0135 Expires: March 31, 1993

4. I hereby certify that the foregoing is true and correct Signed Approved by Conditions of approval, if any:	Title BUSINESS Title Business Title Business	AS AMENDED
Signed a Nayur Brand	OH COM DI	ANALYST 06-26-1994
A I become constitute that the formation in terms	DIEGOTA Julia de 1800 OIL COM, DI BUSIL S	and the second
	DIEGINA Julia 6 1000 OIL COM, DI	and the second
	DEGATA	and the second
	DE GAR	
	Fo	
AMOCO PROPOSES TO PLOG AND AB	BANDON THIS WELL PER THE ATTACHED PROC	EDUKE.
subsurface locations and measured and true vertical depths		
Finel Abandonment Notice		Conversion to Injection Dispose Water Report results of multiple completion on Well Completion or repletion Report and Log form. }
Subsequent Report	Plugging Back Casing Repair	New Construction Non-Routine Fracturing Water Shut-Off
Notice of Intent	Abandonment Recompletion	Change of Plans
TYPE OF SUBMISSION	TYPE OF ACTION	
990FNL 1800FWL	Sec. 20 T 27N R 8W OX(s) TO INDICATE NATURE OF NOTICE	11. County or Parish, State San Juan NM PEROPT OR OTHER DATA
P.O. Box 800, Denver, Colorado 80201 4. Location of Well (Footage, Sec., T., R., M., or Survey Descrip		10. Field and Pool, or Exploratory Area Blanco Pict. Cliffs So.
3. Address and Telephone No.	(303) 830-4912	3004506398
2. Name of Operator Amoco Production Company	Attention: Wayne Branam, RM 1220	Florance D LS 8 9. API Well No.
1. Type of Well Oil Well Well Other		8. Well Name and No.
		7. If Unit or CA, Agreement Designation
	, , , , , , , , , , , , , , , , , , , ,	6. If Indian, Allottee or Tribe Name
	rill or to deepen or reentry to a different reservoir. OR PERMIT - " for such proposals	NM-03380

PXA Procedures Florance D LS #8

- 1. MIRUSU. Blow down well. Kill if necessary with fresh water.
- 2. POOH with 2" tbg and lay down. NDWH. NUBOP. RIH with 2 3/8" workstring and cement retainer, set retainer at 2775'. Squeeze perfs from 2826' to 2844' with 24.124 cuft cement. Pull out of retainer and spot cement plug to 2450'. (65.13 cuft cement)
- 3. RIH with perf gun and shot squeeze holes at 1788'. RIH with tbg and cement retainer, set retainer 50' above the squeeze holes and attempt to circulate to surface with 1060.9 cuft cement. If unable to circulate be sure the following areas are isolated: Ojo Alamo @1784', Nacimiento @842' and 300' to surface. Pull out of retainer and fill hole to surface with 420.84 cuft cement.
- 4. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
- 5. Turn over to John Schwartz for reclamation.
- 6. Rehabilitate location according to BLM or State requirements.

Location - 20C- 27N- 8W SINGLE po Orig.Completion - 9/56 LAST FILE UPDATE - 8/91 BY CSW

