

3-OCC  
1-F

1

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1 ✓
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
**xxxxxx Federal xxxxx**

5. State Oil & Gas Lease No.  
**SF-078896**

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- 2. Name of Operator <b>Beta Development Co.</b>	7. Unit Agreement Name
3. Address of Operator <b>234 Petroleum Club Plaza, Farmington, New Mexico</b>	8. Farm or Lease Name <b>Mudge Federal</b>
4. Location of Well UNIT LETTER <b>G</b> 1850 FEET FROM THE <b>North</b> LINE AND 1450 FEET FROM THE <b>East</b> LINE, SECTION <b>29</b> TOWNSHIP <b>27 N</b> RANGE <b>11 W</b> NMPM.	9. Well No. <b>2</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>6254' GR</b>	10. Field and Pool, or Wildcat <b>Basin Dakota</b>
	12. County <b>San Juan</b>

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK  PLUG AND ABANDON   
 TEMPORARILY ABANDON  CHANGE PLANS   
 PULL OR ALTER CASING  OTHER

SUBSEQUENT REPORT OF:

REMEDIAL WORK  ALTERING CASING   
 COMMENCE DRILLING OPNS.  PLUG AND ABANDONMENT   
 CASING TEST AND CEMENT JOB  OTHER

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Repair casing leaks w/packer and Kem-Pac chemicals, as follows:

Rig up workover rig, circulate out mud, sand and shale to T.D. Circulate until hole is clean. POH. Run Baker Model "D" production packer on wire line. Set packer just below Greenhorn section w/bump out plug to keep any water or Kem-Pac material from getting below packer. GIH w/tbg., Model "D" locator and tail pipe. Spot Kem-Pac above Model "D", set tail pipe down on bump out plug, run tail pipe through Model "D" and land locator seals in packer. Flange up well head, swab well in and re-acidize if necessary.



18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Original signed by: **JOHN T. HAMPTON** SIGNED \_\_\_\_\_ TITLE **Manager** DATE **December 21, 1966**

APPROVED BY: *[Signature]* TITLE *[Signature]* DATE **12-23-66**  
 CONDITIONS OF APPROVAL, IF ANY: