submitted in lieu of Form 3160-5

UNITED STATES

DEPARTMENT	OF	THE	INTERIOR
BUREAU OR	T.AR	TD M	NACEMENT

Sundry Notices and Reports on Well	S
1. Type of Well GAS	5. Lease Number SF-047039C 6. If Indian, All. or Tribe Name
2. Name of Operation	7. Unit Agreement Name
2. Name of Operator Meridian Oil Inc.	
3. Address & Phone No. of Operator	8. Well Name & Number Lackman #2
	9. API Well No.
4. Location of Well, Footage, Sec., T, R, M 1980'FML, 660'FWL Sec.18, T-28-N, R-10-W, NMPM FNL	10. Field and Pool Fulcher Kutz PC 11. County and State
	San Juan Co, NM
12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, Type of Submission Notice of Intent Abandonment Recompletion Subsequent Report Plugging Back Casing Repair Final Abandonment Altering Casing Other -	REPORT, OTHER DATA ion Change of Plans New Construction Non-Routine Fracturing Water Shut off Conversion to Injection
13. Describe Proposed or Completed Operations	
It is intended to plug and abandon this wellbore a attached procedure and wellbore diagram.	ccording to the
DEC31 1992	RECI BI 92 DEC 15 019 FARMIN
OIL CON DIV.) SEE ATTACHED FOR CONDITIONS OF APPROVAL	RECEIVED BLM DEC 15 AMID: 39 FARMINGTON, N.M.
14. I hereby certify that the foregoing is true and co	rrect.
Signed / Walhele Title Regulatory Aff	<u>airs</u> Date 12/15/92
(This space for Federal or State Office use) APPROVED BY	AREROVED
CONDITION OF APPROVAL, if any:	DEC 2.8 1992
acD.	AREA MANAGER

Lackman # 2 Recommend P&A Procedure Unit E Section 18 T28N R10W

NOTE: 24 Hours before activity, notify BLM (326-6201) & NMOCD (327-5344).

- 1. MOL and RU. Comply to all NMOCD, BLM and MOI rules & regulations. Hold safety meeting. ND wellhead. NU BOP. Blow well down, if necessary, kill with water.
- 2. TIH w/ 1-1/4" tbg to 1960'. Displace 30 sxs (this will fill csg from 1960' to 900 ' w/ 100% excess across perfs). Pull tbg up to 950' and circ hole clean with water. TOOH.
- 3. Perf 2 sq holes @ 900'. Establish circulation out bradenhead. When circulation is established, pump cmt down csg and circulate good cmt out bradenhead (approx 550 sxs).
- 4. Cut off wellhead below surface casing flange, install dry hole marker and restore location according to Federal and State specifications.
- 5. RD workover rig. MOL.

A		
Approve:	R. F. Headrick	


VENDORS:

A-Plus Well Service: 325-1211

KAS:kas

CURRENT LACKMAN # 2


UNIT E SECTION 18 T28N R10W SAN JUAN COUNTY, NEW MEXICO

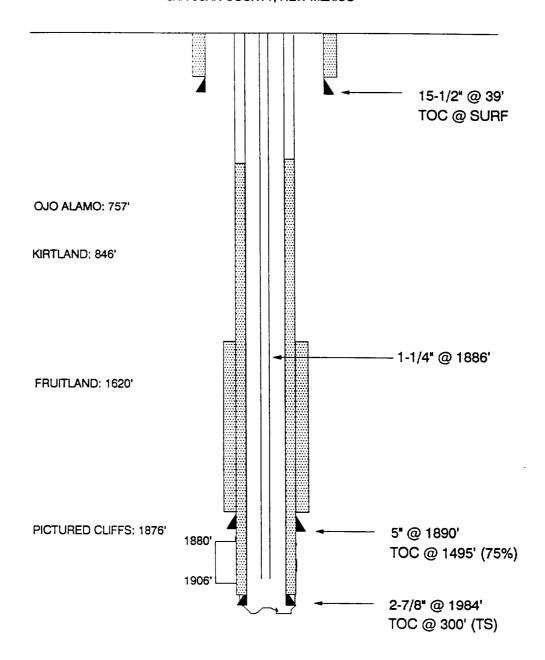

PROPOSED

LACKMAN # 2

UNIT E SECTION 18 T28N R10W SAN JUAN COUNTY, NEW MEXICO

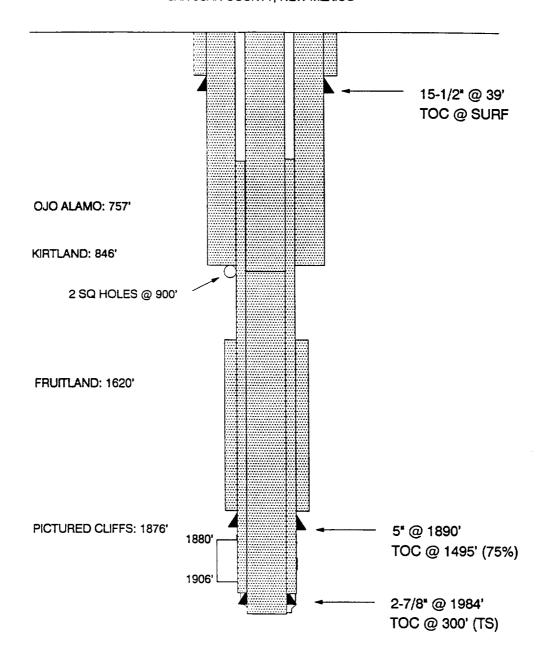

IN REPLY REFER TO (019)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT FARMINGTON RESOURCE AREA 1235 LA PLATA HIGHWAY FARMINGTON, NEW MEXICO 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: 2 Luckmun

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal Leases."

2. May 12 // with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907

- Blowout prevention equipment is required.
- 4. The following modifications to your plugging program are to be made (when applicable):

1) Pressure test casing before perfurating a goo!

2) After the cement is circulated out the brudenhand, displace the cement in the 27% casing to 90' and circulate cement that the 27% casing a 90' and circulate cement that the 27% x 5 annulus to the surface.

office Hours: 7:45 a.m. to 4:30 p.m.