

submitted in lieu of Form 3160-5

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED
BLM

Sundry Notices and Reports on Wells

98 NOV 24 PM 2:18

070 FARMINGTON, NM

1. Type of Well
GAS

5. Lease Number
88080724-A
6. If Indian, All. or
Tribe Name

2. Name of Operator

**BURLINGTON
RESOURCES**

OIL & GAS COMPANY

RECEIVED
DEC - 2 1998

7. Unit Agreement Name

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

OIL & GAS COMPANY

8. Well Name & Number

Zachry #38

9. API Well No.

30-045-25464

10. Field and Pool

Gallup

11. County and State

San Juan Co, NM

4. Location of Well, Footage, Sec., T, R, M

1800' FSL 1845' FWL, Sec. 12, T-28-N, R-10-W, NMPM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment

Type of Action

☐ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☒ Other -

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut off

☐ Conversion to Injection

13. Describe Proposed or Completed Operations

It is intended to repair the tubing on the subject well according to the attached procedure.

14. I hereby certify that the foregoing is true and correct.

Signed Duane W. Specter (KLM2) Title Regulatory Administrator Date 11/18/98
TLW

(This space for Federal or State Office use)

APPROVED BY /s/ Duane W. Specter Title _____ Date DEC 1 1998

CONDITION OF APPROVAL, if any:

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

NMOC

Zachry #38
Gallup
1800' FSL & 1485' FWL
Unit K, Section 12, T28N, R10W
Latitude / Longitude: 36° 40.4590' / 107° 50.9464'
DPNO: 32388A
Tubing Repair Procedure

Project Summary: The Zachry #38 was drilled in 1982. Rods and a pump were installed in 1983. We propose to pull the tubing, pull rods, check for fill, replace any worn or scaled tubing, add production equipment and add a plunger lift.

1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. **Notify BROG Regulatory (Peggy Broadfield 326-5727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS WIMS.** Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Hot oil the well to dissolve any paraffin. Pull the rods and lay down. Blow well down and kill with 2% KCL water if necessary. ND WH, NU BOP. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
3. The Gallup tubing is 2-3/8", 4.7#, K-55 set at 5983' with a seating nipple at 5920'. Release donut, pick up additional joints of tubing and tag bottom (record depth.) PBTD should be at +/- 6113'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
4. If fill covers any perforations then TIH with 4-3/4" bit and a watermelon mill on 2-3/8" tubing to below perforations, cleaning out with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary. TOOH with tubing. **NOTE: When using air/mist, minimum mist rate is 12 bph.**
5. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom. Run a broach on sandline to insure that the tubing is clear. Land tubing at approximately 6020'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. If well will not flow on it's own, make swab run to SN. RD and MOL. Return well to production.
6. Production operations will install the plunger lift.

Recommended: *Kevin Midkiff* 11/9/98
Operations Engineer

Approved:

Bruce W. Boyer 11-9-98
Drilling Superintendent

Kevin Midkiff
Office - 599-9807
Pager - 564-1653