## State of New Mexico

Form C-103 Submit 3 Copies Energy, Minerals and Natural Resources Department Revised 1-1-89 to Appropriate District Office OIL CONSERVATION DIVISION DISTRICT I WELL API NO. P.O. Box 1980, Hobbs NM 88241-1980 2040 Pacheco St. 30-039-07483 Santa Fe, NM 87505 DISTRICT II 5. Indicate Type of Lease P.O. Drawer DD, Artesia, NM 88210 STATE [ FEE X DISTRICT III 6. State Oil & Gas Lease No. 1000 Rio Brazos Rd., Aztec, NM 87410 SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A 7. Lease Name or Unit Agreement Name DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.) 1. Type of Well: San Juan 29-5 Unit 009256 GAS WELL WELL OTHER 017654 8. Well No. 2. Name of Operator SJ 29-5 Unit #37 Phillips Petroleum Company 9. Pool name or Wildcat 3. Address of Operator 72319 Blanco Mesaverde 5525 Highway 64, NBU 3004, Farmington NM 87401 4. Well Location South 1170 West 1750 Feet From The Feet From The Line and Line Unit Letter 5W Rio Arriba 29N **NMPM** County Township Range 10. Elevation (Show whether DF, RKB, RT, GR, etc.) Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data 11. **SUBSEQUENT REPORT OF:** NOTICE OF INTENTION TO: ALTERING CASING PLUG AND ABANDON REMEDIAL WORK PERFORM REMEDIAL WORK COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT **CHANGE PLANS TEMPORARILY ABANDON** CASING TEST AND CEMENT JOB PULL OR ALTER CASING OTHER: Removed CIBP & returned all zones to prod. OTHER: 12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103. The subject well had the Lewis Shale interval of the Mesaverde completed in 10/98. The CIBP was left in hole to flow test the Lewis Shale. The CIBP has now been removed and all intervals within the Mesaverde formation will be produced. Details of procedure used to complete work as follows: 9/7/99 MIRU Key Energy #29. Kill well w/40 bbls water. ND WH & NU BOP. PT BOP-OK. COOH w/2-3/8" tubing. RIH w/4-3/4" bit & tagged sand @ 4982'. Cleaned out fill to CIBP @ 5000'. Drilled out CIPB. Circulated hole. COOH. RIH w/2-3/8" tubing and cleaned out to PBTD @ 5740'. Landed tubing @ 5648' with "F" nipple set @ 5612'. ND BOP & NU WH. PT - OK. Pumped off expendable check. and RD & released rig. Returned well to production.

I have be a series about the African shows the	pove is true and complete to the best of my ki	nowledge and belief.		
SIGNATURE	- Clusim	TITLE Regulatory Assistant	DATE	9/9/99
TYPE OR PRINT NAME	Patsy Clugston		TELEPHONE NO.	505-5993-3454
(This space for State Use)			SEP	2 0 1999
DRIGINAL SIGNED BY ERNIE BUSCH		DEPUTY OIL & GAS INSPECTOR, DIST.	DATE	20 1000
APPROVED BY		_ TITLE	DATE	