

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
Budget Bureau No. 1004-0135  
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☒ Gas Well ☐ Other

2. Name of Operator

Amoco Production Company Attn: John Hampton

3. Address and Telephone No.

P.O. Box 800 Denver, Colorado 80201

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

1850' FNL, 1650' FEL Sec. 8, T29N-R9W Unit "G"

5. Lease Designation and Serial No.

SF-076377

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Heath Gas Com D #1

9. API Well No.

30-045-08546

10. Field and Pool, or Exploratory Area

Blanco Mesaverde

11. County or Parish, State

San Juan, NM

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent  
☐ Subsequent Report  
☐ Final Abandonment Notice

TYPE OF ACTION

- ☐ Abandonment  
☐ Recompletion  
☐ Plugging Back  
☐ Casing Repair  
☐ Altering Casing  
☒ Other Bradenhead Repair  
☐ Change of Plans  
☐ New Construction  
☐ Non-Routine Fracturing  
☐ Water Shut-Off  
☐ Conversion to Injection  
☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

Amoco intends to perform the attached workover procedure required to eliminate bradenhead pressure.

In addition, Amoco also requests approval to construct a temporary 15'X15'X5' blow pit for return fluids. This pit will be reclaimed if utilized, upon completion of this operation.

RECEIVED  
MAR 4 1992  
OIL CON. DIV.  
DIST. 9

APPROVED

MAR 19 1992  
AREA MANAGER

RECEIVED  
BLM  
MAR 12 AM 11:39  
SANTAMONIO, N.M.

Please contact Cindy Burton (303) 830-5119 if you have any questions.

14. I hereby certify that the foregoing is true and correct

Signed

*J. F. Hampton*

Title

Sr. Staff Admin. Supv.

Date

3/9/92

(This space for Federal or State office use)

Approved by


Title

Date

Conditions of approval, if any:

NMOCD

HEATH GAS COM D #1  
 LOCATION, G08-29N-09W  
 SINGLE MV  
 ORIGINAL COMPLETION 9/53  
 LAST FILE UPDATE 10/91 BY CSW

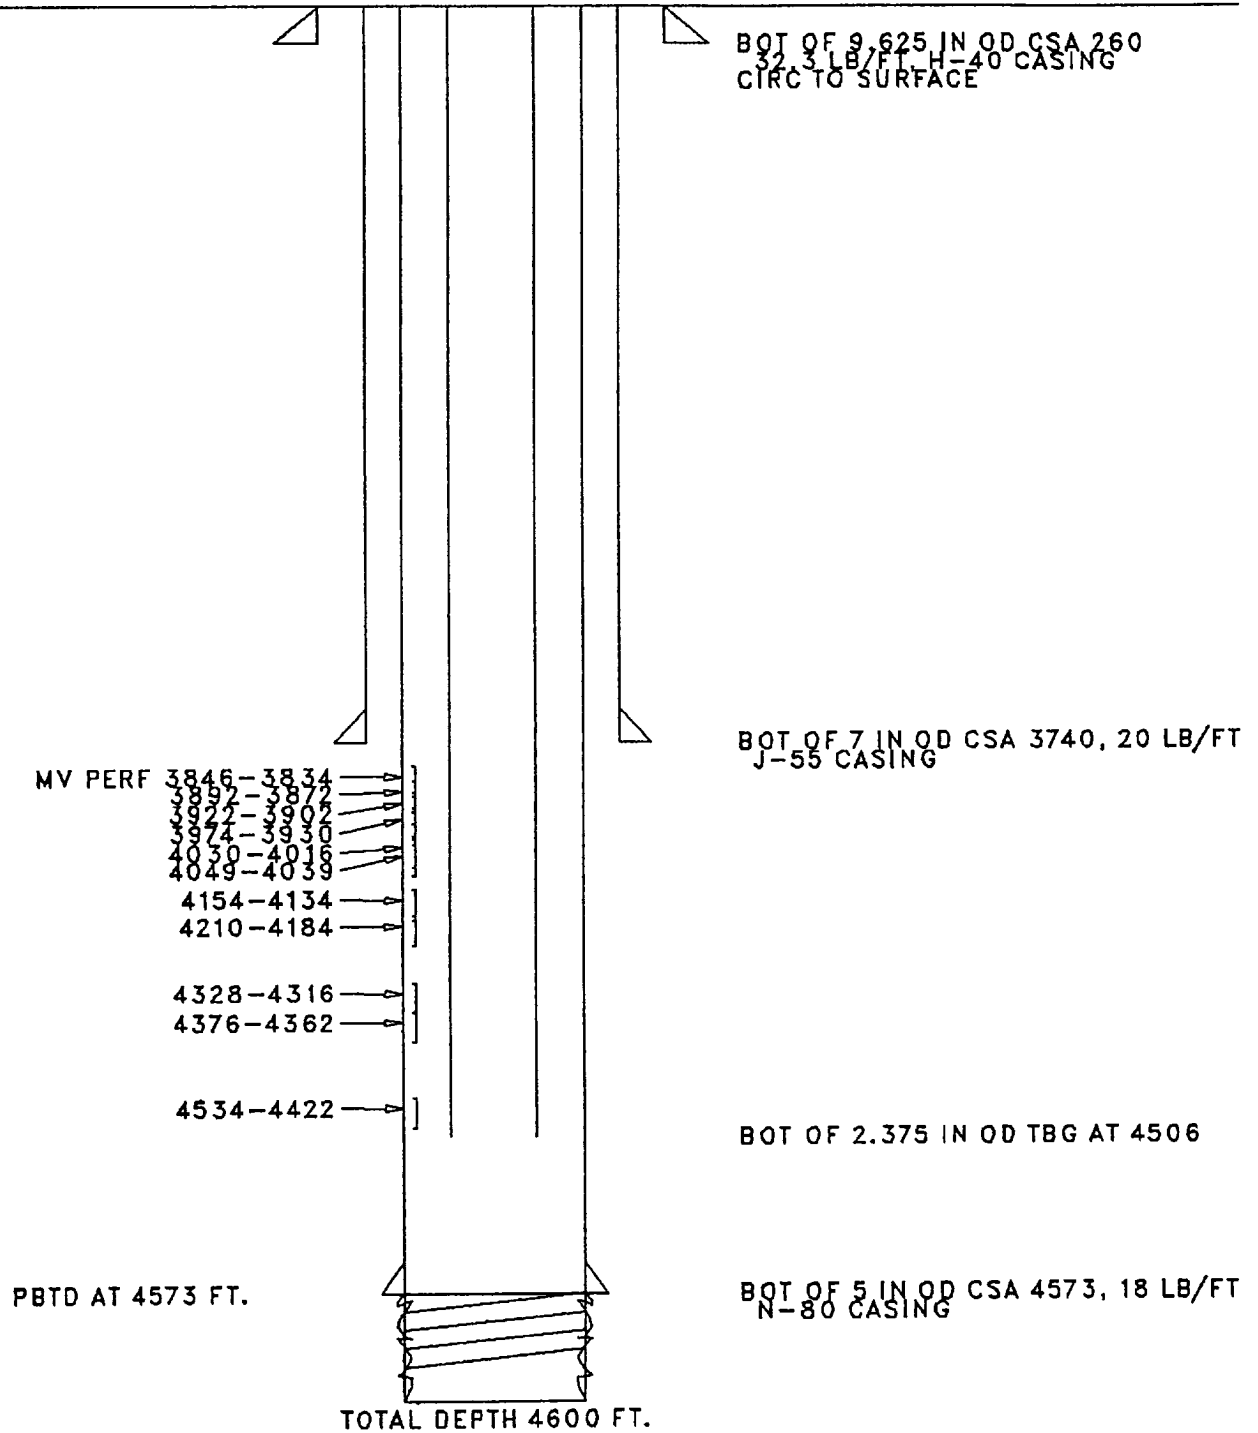

FILENAME:  
 3050

Workover Procedure  
Heath Gas Com D #1  
Sec.08-T29N-R09W  
San Juan County, NM

1. Contact Federal or State agency prior to starting repair work.
2. Catch gas and/or water sample off of bradenhead and casing, and have analyzed.
3. Install and/or test anchors.
4. MIRUSU. Check and record tubing, casing and bradenhead pressures.
5. Blow well down, kill well if necessary with 2% KCL.
6. Nipple down well head, nipple up and pressure test BOP's.
7. Trip in the hole and tag PBTD, check for fill, trip and tally out of hole with tubing checking condition of tubing.
8. Trip in the hole with bit and scraper to the top of the perforations. A seating nipple and standing valve may be run in order to pressure test the tubing.
9. Trip in the hole with RBP and PKR. Set RBP 50-100 ft. above perforations. Trip out of hole one joint and set PKR and pressure test RBP to 1500 psi. Release PKR and pressure test csg to 1000 psi. If no leak is found, spot sand on RBP, trip out of hole and skip step 10.
10. Trip out of hole isolating leak in casing. NOTE: Once leak is located contact Brent Miller in Denver at (303) 830-4049. Spot sand on RBP and trip out of hole with PKR.
11. Determine from well file and history if a CBL needs to be run from the top of RBP to bottom of intermediate casing shoe. If this is needed, run CBL under 1000 psi and report results to Denver.
12. Bleed off any intermediate casing pressure and check for flow, fill annulus with 2% KCL water. Nipple down BOP's and tubing head, spear casing and remove slips, nipple up BOP's.
13. Run freepoint and back off casing as deep as possible but not below the intermediate casing shoe. Trip out of hole laying down and checking condition of casing.

14. Trip in the hole with bit and scraper to top of casing back off, circulate hole clean and trip out with scraper.
15. Trip in the hole with RBP and PKR and set RBP above casing backoff, trip out of hole one joint and set PKR and pressure test RBP.
16. Release packer and trip out of hole isolating leak in casing. NOTE: IF this can not be accomplished contact Brent Miller in Denver (303) 830-4049.
17. Release PKR and spot sand on RBP and trip out of hole.
18. Run, if necessary a CBL & CCL to determine cement top on the intermediate casing.
19. Perforate casing, if necessary with 4 JSPF and circulate dye to determine cement volume. Depending on the depth of the hole and circulating pressure, a PKR or a cement retainer may be needed.
20. Mix and pump sufficient (with two hour setting time) to circulate to surface. Shut bradenhead valve and attempt to obtain a squeeze pressure and WOC.
20. Mix and pump sufficient cem
21. Trip in the hole with bit and scraper and drill out cement and pressure test casing. Re-squeeze leaks if casing fails pressure test.
22. Trip in the hole with retrieving head for RBP, circulate sand off of RBP and trip out of hole with plug.
23. Trip in the hole with casing and tag casing backoff. Circulate the top of the back off clean with 2% KCL water. Circulate PKR fluid to fill annulus if no additional squeeze work is required. This will be determined from the previous CBL run. Tie back onto production casing and pressure test casing.
24. Nipple down BOP's and tubing head, set slips and make cut off. Install tubing head and BOP's and pressure test.
25. Trip in the hole with retrieving head for RBP, circulate sand off of RBP with 2% KCL and trip out of hole with plug.
26. Trip in hole with a sawtooth collar and/or bailer and clean out to PBSD and trip out of hole.
27. Trip in the hole with the production string (1/2 mule shoe on bottom and a seating nipple one joint off bottom), land tubing to original depth. Nipple down BOP's, nipple up well head.

28. Swab well in and put well on production.

29. Rig down move off service unit.