

Submit 3 Copies To Appropriate District Office

District I

1625 N. French Dr., Hobbs, NM 88240

District II

811 South First, Artesia, NM 88210

District III

1000 Rio Brazos Rd., Aztec, NM 87410

District IV

1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103

Revised March 25, 1999

WELL API NO.

30-045-20686

5. Indicate Type of Lease

STATE FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name:

Gutierrez Gas Unit C

8. Well No.

1

9. Pool name or Wildcat

Blanco Pictured Cliffs

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

Oil Well ☐ Gas Well ☒ Other

2. Name of Operator

BP America Production Company

Attn: Mary Corley

3. Address of Operator

P.O. Box 3092 Houston, TX 77253

4. Well Location

Unit Letter A 800 feet from the North line and 960 feet from the East line

Section 04 Township 29N Range 09W NMPM San Juan County

10. Elevation (Show whether DR, RKB, RT, GR, etc.)
5634'

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐

OTHER:

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER:

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

BP America Production Company respectfully request permission to plug and abandon the subject well per the attached procedure.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Corley TITLE Sr. Regulatory Analyst DATE 06/27/2001

Type or print name Mary Corley Telephone No. 281-366-4491

(This space for State use)

APPROVED BY _____ TITLE _____ DATE JUL 19 2002

Conditions of approval, if any:

Gutierrez GC C #1 P&A Procedure

Procedure:

Note: *Notify regulatory agencies (NMOCD- Charlie Perrin 505-334-6178x16 and BLM- 505-599-8907) 24 hours prior to beginning the P&A operations.*

1. Check anchors. MIRU workover rig.
2. Check and record tubing, casing, and bradenhead pressures.
3. Blow down wellhead. Kill with water if necessary.
4. Nipple down WH. NU BOP's.
5. TOH and LD 1-1/4" production tubing currently landed at 2281'.
6. PU 2-3/8" workstring.
7. TIH with tubing-set 4-1/2" CIBP. Set CIBP at 2225'. PU and spot 375' cement plug (34 cu ft) above CIBP from 1850'-2225' to cover Picture Cliffs and Fruitland intervals.
8. TOH to 1200'. Spot 200' cement plug (18 cu ft) across the Ojo Alamo from 1000'-1200'.
9. TOH to 250'. Spot 250' surface plug (23 cu ft) from 0'-250'. TOH and LD 2-3/8" workstring.
10. ND BOP's. Cut off wellhead and install P&A marker.
11. RDMO workover rig.