Submit 3 Copies to Appropriate District Office

### State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

FEE 🗵

	רפו	יםי	$\Gamma$	
_		- 1	$\sim$ 1	

P.O. Box 1980, Hobbs, NM

OIL CONSERVATION DIVISION

<u>DISTRICT II</u>
--------------------

P.O.Box 2088 Santa Fe, New Mexico 8750492088

30-045-21080

\_ DATE \_

P.O. Drawer DD, Artesia, NM 88210

5. Indicate Type of Lease STATE  $\square$ 

WELL API NO.

DISTRICT III

1000 Rio Brazos Rd	., Aztec, NM				22.5	Diam's	ED '	Same Oil & Gas L	ease No.	
(DO NOT USE THI	S FORM FOR	PROPOS/	S AND REPOR ALS TO DRILL . USE "APPLI FOR SUCH PE	OR TO D	EEPEN OF OR PERM	PLUG BACK T	5		Init Agreement N	ame
1. Type of Well:	GAS WELL	X	OTI	ier					, cas co	
2. Name of Operator AMOCO PRODUC			Aı	tention:	Melissa	Velasco-Price		3. Well No.	1	
P.O. Box 3092	Houston	TX	7725	3 2	81-366-2	548	9	9. Pool name or Wild Blance	dcat o Pictured Cliffs	
4. Well Location Unit Letter	N :	290 <sub>F</sub>	eet From The_	so	UTH	Line and	1330	Feet From Th	neWEST	ΓLine
Section	06	Te	ownship	29N	Rang	09W	NMI	PM Sa	an Juan	County
			10. Elevati	on (Show w	whether DF 5943	, <i>RKB, RT, GR,</i> GR	etc.)			
11.	Check A	Appropria	te Box to In	dicate N	ature of l	Notice Repor	t or Oth	er Data		

PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING  TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT PULL OR ALTER CASING CASING CASING TEST AND CEMENT JOB	NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:			
	PERFORM REMEDIAL WORK PL	IG AND ABANDON	REMEDIAL WORK	ALTERING CASING		
PULL OR ALTER CASING CASING TEST AND CEMENT JOB	TEMPORARILY ABANDON C	ANGE PLANS	COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT		
	PULL OR ALTER CASING		CASING TEST AND CEMENT JOB			
OTHER: BLM Letter 1/18/00 X OTHER:	DTHER: BLM Letter 1/18/00	X	OTHER:	<del></del>		

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed

Amoco Production Company request permission to plug and abandon the subject well per attached work well procedure.

(This space for State Use) CHAPLE T. PERFON	DEPUTY OIL & GAS INSPECTOR, DIST.	281-366-2548	
I hereby certify that the information above is true and complete to the best of my signature \( \frac{1}{2} \) \( \frac^		04-26-2000	

\_ TITLE -

CONDITIONS OF APPROVAL, IF ANY:

APPROVED BY \_\_

Hare GC E 1 (PC)

Original Completion: 1/73

TD = 2,275' PBTD = 2,237'

Objective: PXA entire wellbore

### Page 2 of 2

- 1. Notify regulatory agencies (BLM, NMOCD, FIMO) 24 hours in advance of plugging activity. Contact BLM and indicate well is allotted (FIMO regulations effective April 1, 1997).
- 2. Check location for anchors. Install if necessary. Test anchors.
- 3. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
- 4. TOH with 1 ½" tubing. TIH with 1 ½" tubing workstring and CIBP. Set CIBP at 2,100'. Spot cement plug from 2,100' to 2,000' (8 sacks). TOH to 1,660', spot cement plug from 1,660' to 1,560' (8 sacks). TOH to 1,122', spot cement plug from 1,122' to 845' (22 sacks). TOH to 276', spot cement plug from 276' to surface (22 sacks).
- 5. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
- 6. Contact FMC and ship surface equipment to yard or other location per instructions.
- 7. Provide workorder to Buddy Shaw for reclamation.
- 8. Rehabilitate location according to BLM or State requirements.

# Hare GC E 1 (PC)

## N6 T29N-R9W, 1330' FWL, 290' FSL API 3004521080 SF-080751

### **Proposed PXA Wellbore Schematic**

