

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

## Sundry Notices and Reports on Wells

1. Type of Well  
GAS

**RECEIVED**  
JUN 3 1998

2. Name of Operator

**BURLINGTON  
RESOURCES**

OIL & GAS COMPANY

**OIL CON. DIV.  
DIST. 3**

3. Address & Phone No. of Operator

PO Box 4289, Farmington, NM 87499 (505) 326-9700

4. Location of Well, Footage, Sec., T, R, M

1730' FNL, 790' FWL, Sec.30, T-30-N, R-7-W, NMPM

5. Lease Number  
NM-012709

6. If Indian, All. or  
Tribe Name

7. Unit Agreement Name

San Juan 30-6 Unit

8. Well Name & Number  
San Juan 30-6 U #7A

9. API Well No.  
30-039-21700

10. Field and Pool  
Blanco Mesaverde

11. County and State  
Rio Arriba Co, NM

12. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OTHER DATA

Type of Submission

Type of Action

<input checked="" type="checkbox"/> Notice of Intent	<input type="checkbox"/> Abandonment	<input type="checkbox"/> Change of Plans
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Recompletion	<input type="checkbox"/> New Construction
<input type="checkbox"/> Final Abandonment	<input type="checkbox"/> Plugging Back	<input type="checkbox"/> Non-Routine Fracturing
	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> Water Shut off
	<input type="checkbox"/> Altering Casing	<input type="checkbox"/> Conversion to Injection
	<input checked="" type="checkbox"/> Other - Tubing repair	

13. Describe Proposed or Completed Operations

It is intended to repair the tubing in the subject well according to the attached procedure.

OIL FIELD DIVISION, NM  
JUN 27 PM 1:00  
60415

14. I hereby certify that the foregoing is true and correct.

Signed Nancy Altman (KLM7) Title Regulatory Administrator Date 5/26/98

(This space for Federal or State Office use)

APPROVED BY A/ Darro W. Spencer Title \_\_\_\_\_ Date JUN - 1 1998

CONDITION OF APPROVAL, if any:

**San Juan 30-6 Unit No. 7A**  
**Mesa Verde**  
**1730' N, 790' W**  
**Unit F, Section 30, T-30-N, R-07-W**  
**Latitude / Longitude: 36° 47.1652' / 107° 36.9140'**  
**DPNO: 69730**  
**Tubing Repair Procedure**

**Project Summary:** San Juan 30-6 Unit No. 7A was drilled in 1978 as a Mesa Verde producer. The well has a sanding problem. Tubing pulled and fill was encountered and cleaned out in 10/96 and 2/97. Flow boss was installed in 3/97. I propose to pull the tubing, check for fill and replace any worn or scaled tubing.

1. Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. **Notify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS.** Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
3. The Mesa Verde tubing is 2-3/8", 4.7#, J-55 set at 5631'. Release donut, pick up additional joints of tubing and tag bottom (record depth). PBTD should be at +/- 5708'. TOO H with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
4. If fill covers any perforations then TIH with 3-7/8" bit and a watermelon mill on 2-3/8" tubing to below perforations, cleaning out with air/mist. **NOTE: When using air/mist, minimum mist rate is 12 bph.**
5. PU above the perforations and flow the well naturally, making short trips for clean up when necessary. TOO H with tubing. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom. Run a broach on sandline to insure that the tubing is clear. Land tubing at approximately 5630'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. If well will not flow on it's own, make swab run to SN. RD and MOL. Return well to production.

Recommended: *K. Midkiff* 5/20/98 Operations Engineer Approved: *Bruce D. Bony* 5-25-98 Drilling Superintendent

Kevin Midkiff  
Office - 599-9807  
Pager - 564-1653