UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

			/	
90 JAN 29 /	Sundry Not	ices and Reports on	Wells	
1. Type of		FEB 0 7 1990	5. Lease Number NM-04052 6. If Indian, All Tribe Name	.or
		OIL CON. DIV.	7. Unit Agreement	. Name
2. Operato	r	DIST. 3	San Juan 30-6	
	Natural Gas Compa	nv		
22 2 400			8. Farm or Lease	Name
3. Address	& Phone No. of Op	erator	San Juan 30-6	Unit
PO Box	4289, Farmington,	NM 87499	9. Well No.	
			476	7.4
4. Location of Well 1060'N, 825'E			10.Field,Pool, Wildcat Basin Fruitland Coal	
1060'N,	825'E	11.Sec. T. R. M.		
			Sec.28, T-30-N,	
			NMPM	
14. Permit	No.	15. Elevations		State
		6335'GR	Rio Arriba	NM
16. Intent to/Subsequent Report of :				
17. Describe proposed or completed operations:				
I'. Debell	De proposed of our	-F		
12-11-89	Mol ru. Tih w/bi	t. Tag @ 2948'.		
12-12-89	Drld cmt to 2995'. Drld open hole from 2995-3065.			
12-13-89	Drld 3065-3259' TD. Circ. hole clean w/wtr.			
12-14-89	Blow to pit.			
12-15-89	Blow to pit.			
12-16-89 12-17-89	Work stuck pipe. Work stuck pipe @ 3214'.			
12-17-89	Prep to run freepoint.			
12-19-89	Ran freepoint & back off @ 2936'. Pooh w/dp. Tih w/fishing			
12 13 03	tools. Screw int	o fish. Fish stuck.	Prep to run free	epoint.
12-20-89	Ran freepoint & b	ack off @ 2985'. Ra	n freepoint & back	off @
2953'. Circ. Pooh & change fishing tools. Tih & caught fis				
	Jarred on fish.			
12-21-89		backoff @ 2969'. Poo	n & change fishing	f tools.
10 00 00	Tih & caught fish	a. Jarred on fish. vashover fish. Pooh	20 etde Miv mud	£ nren
12-22-89	to kill well.	ashover rish. Foon	20 scus. Mix muu	α breb
12-23-89		59 ′ .		
12-25 05	CONTINUED ON NEXT			
		* · · · ·	, , , ,	
18. Author	ized by:	Machield	1-26-70	
	Regulator	Delaticed Affairs	Da	ite
NOTE: This format is issued in lieu of US BLM Form 3160-5				
=========				
(This space for Federal or State office use)				
APPROVED E	BY	TITLE	DATE	
CONDITION	OF APPROVAL, IF AN	TITLE	Shr	

- 12-26-89 Bled down thru choke. Plugged off. Pulled 2 jts dp. Dp plugged. Ru swabbing unit.
- 12-27-89 Jar on stuck dp. Jarred free & circ. Prep to tih to circ & cond.
- 12-28-89 Tag @ 1999'. Pooh. Left 2 jts washpipe in hole. Rd snubbing unit. Tih w/bit. TOF @ 1931'. Circ.
- 12-29-89 Clean out inside of wash pipe to 2003'. Pooh. Fished lost washpipe. Tih w/bit. Circ & cond @ 2083'.
- 12-30-89 Circ & clean out to TOF @ 3159'.
- 12-31-89 Circ. Pooh. Fished lost dp. Tih, circ @ base of 7" csq.
- 1-1-90 Circ mud & displace w/wtr. Blow w/air & wtr.
- 1-2-90 Blow to pit @ 3162.
- 1-3-90 Blow to pit.
- 1-4-90 Blow to pit, clean out to 3176'.
- 1-5-90
- Blow to pit. Attempt to clean out. Blow to pit. Attempt to clean out. 1-6-90
- 1-7-90 Blow to pit. Stuck pipe @ 3155'.
- 1-8-90 Mix mud. Ru & ran freepoint. Back off @ 2716'. Ran second freepoint & back off @ 2623'. Circ. Pooh. Pu fishing tools. Tih & circ @ TOF.
- 1-9-90 Latch on fish. Rotate & work fish up hole to 3113'
- 1-10-90 Pooh. Recovered 3.15' fish, split below tool jt. Tih w/fishing tools. Caught fish pooh & ld. Pu bit & tih. Co to 3008'.
- 1-11-90 Circ & clean out to 3234'.
- 1-12-90 Clean out to 3259' TD.
- 1-13-90 Ran 8 jts of 5 1/2", 23.0#, P-110 liner set @ 3258'. Top of liner hanger @ 2923'. Predrilled perfs @ 3014' to 3256'.
- 1-14-90 Finished milling perf plugs. Blow to pit.
- 1-15-90 Blow to pit.
- 1-16-90 Blow to pit.
- 1-17-90 Blow to pit.
- 1-18-90 Landed 104 jts, 2 7/8", 6.5#, J-55, Eue, 8rd, tbg (3194.61) @ 3212', f-nip @ 3108'. Rig released.