

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240
DISTRICT II
P.O. Drawer DD, Artesia, NM 88210
DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	3004507873
5. Indicate Type of Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	Sanchez Gas Com B
8. Well No.	#1
9. Pool name or Wildcat	Basin Dakota


SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	
2. Name of Operator AMOCO PRODUCTION COMPANY	Attention Pat Archuleta
P.O. Box 800 Denver Colorado 80201 303-830-5217	
4. Well Location Unit Letter G : 1650 Feet From The NORTH Line and 2100 Feet From The EAST Line Section 28 Township 29N Range 10W NMPM SAN JUAN County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.)	

11. Check Appropriate Box to Indicate Nature of Notice Report or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/> PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER: <input type="checkbox"/>	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Amoco Production Company requests permission to plug and abandon this well per the attached procedures.

If you have any questions contact Dave Smith at (303) 830-4502.

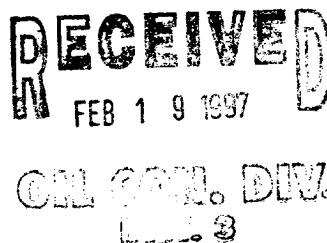

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Pat Archuleta TITLE Staff Assistant DATE 02-18-1997
TYPE OR PRINT NAME Pat Archuleta TELEPHONE NO. 303-830-5217

(This space for State)

APPROVED BY Johnny Robinson TITLE DEPUTY OIL & GAS INSPECTOR, DIST. #3 DATE FEB 19 1997
CONDITIONS OF APPROVAL, IF ANY:

NOTIFY AZTEC OCD
IN TIME TO WITNESS P+A

1. Check location for anchors. Install if necessary. Test anchors.
2. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
3. POOH with 2 3/8" tbg. Spot cement plug from 3300' to 3550' (27 cuft cement), to cover Mesaverde.
4. RIH with perf gun and shoot squeeze holes at 1517'. RIH with cement retainer, set retainer at 1467'. Cement squeeze with 25 sx cement, making sure to leave 4 sx (50') cement on top of retainer.
5. RIH with perf gun and shoot squeeze holes at 800'. RIH with cement retainer, set retainer at 750'. Cement squeeze with 25 sx cement, making sure to leave 4 sx (50') cement on top of retainer.
6. Set 100' surface plug (13 cuft cement).
7. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
8. Contact FMC and ship surface equipment to yard or other location per instructions.
9. Turn over to John Schwartz for reclamation.
10. Rehabilitate location according to BLM or State requirements.