

3/09/00

NO PRESSURE ON WELL THIS AM. TOO H AND LD BIT. PU 3-3/4" WASHOVER SHOE, 9 JTS. 3-3/4" WASH PIPE, XO, JARS, AND TIH W/ 6 JTS. 3-1/8" DRILL COLLARS, AND 160 JTS. 2-3/8" TBG. TO FISH @ 5518'. PU 2.5 POWER SWIVEL. TAG SAND @ 5600'. BREAK CIRCULATION W/ AIR AND WASH OVER FISH TO 5781'. TOO H AND LD WASHOVER SHOE. SION. DAY-5.

3/10/00

NO PRESSURE ON WELL THIS AM. PU 3-3/4" OVERSHOT W/ 2-19/32" GRAPPLE, BUMPER SUB, JARS, AND TIH W/ 6 JTS. 3-1/8" DRILL COLLARS, AND 165 JTS. 2-3/8" TBG. TO FISH @ 5518'. LATCH ONTO FISH. JARRED ON FISH FOR 2 HRS. NO LUCK. TRY TO RELEASE OVERSHOT. NO LUCK. RU WEATHERFORD WIRELINE. RIH W/ WIRELINE AND DID CHEMICAL CUT @ 5524'. RD WIRELINE. TOO H AND LD 8.50' CUT OFF PIECE OF TUBING. PU 4-1/2" CASING SCRAPER, AND TIH W/ 2-3/8" TBG. TO 1700'. TOO H AND LD CASING SCRAPER. SION. DAY-6.

3/11/00

NO PRESSURE ON WELL THIS AM. PU MILL AND TIH TO TOP OF FISH @ 5524'. PU 2.5 POWER SWIVEL. BREAK CIRCULATION W/ AIR AND MILL 6' OF TBG. TO 5530'. TOO H AND LD MILL. PU OUTSIDE CUTTERS AND TIH. PU 2.5 POWER SWIVEL. CUT OUTSIDE OF TBG. @ 5744'. TOO H AND LD CUTTERS, AND 7 JTS. 2-3/8" TBG. W/ CUT OFF PIECE. PU 3-3/4" WASHOVER SHOE, AND TIH TO 5723'. SION. DAY-7.

3/13/00

120# ON WELL THIS AM. BLED DOWN. RIH AND TAG SAND @ 5775'. PU 2.5 POWER SWIVEL. BREAK CIRCULATION W/ AIR AND CLEAN OUT TO 5781'. TOO H AND LD WASHOVER SHOE. PU 3-3/4" OVERSHOT W/ 2-19/32" GRAPPLE AND TIH TO TOP OF FISH @ 5744' AND LATCH ONTO. JAR ON FISH FOR 5 HRS. W/ NO LUCK. GOT OFF FISH AND TOO H. PU 3-3/4" WASHOVER MILL, AND TIH TO 5000'. SION. DAY-8.

3/14/00

260# ON WELL THIS AM. BLED DOWN. FIH TO 5781' AND TRY TO MILL TOP OF WASHPIPE. NO LUCK. TOO H AND LD ALL TOOLS.