Submit 3 Copies to Appropriate

## State of New Mexico Energy, Minerals and Natural Resources Department

Form C-103 Revised 1-1-89

District Office		<del>-</del>	
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATIO	N DIVISION	
P.O.Box 2088			WELL API NO.
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mexico 87504-2088		3004507985
			5. Indicate Type of Lease  STATE FEE X
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410	)		STATE FEE STATE FEE STATE Oil & Gas Lease No.
		*. *	o. State On & Gas Lease No.
SUNDRY NOT	ICES AND REPORTS ON V	WELLS	
(DO NOT USE THIS FORM FOR PRO	OPOSALS TO DRILL OR TO DEEP	PEN OR PLUG BACK TO A	7 Lance Name of Unit Assessed N
DIFFERENT RESER	VOIR. USE "APPLICATION FOR	PERMIT"	7. Lease Name or Unit Agreement Name
1. Type of Well:	-101) FOR SUCH PROPOSALS.)		Pearce Gas Com
	1		
***************************************			
Name of Operator     Amoco Production Company	Attention:	lata Danier 10050	8. Well No.
3. Address of Operator	Pat Archuleta, Room 1205C		#1
P.O. Box 800 Denver	Colorado 80201	(303) 830-5217	9. Pool name or Wildcat
4. Well Location			Basin Dakota
Unit Letter K : 147	0 Feet From The Sout	h Line and 17	75 Feet From The West Line
		Diffe and	Feet From The Line
Section 23	Township 29N	Range 11W N	IMPM San Juan County
		ther DF, RKB, RT, GR, etc.)	MPM San Juan County
	Tot Ziovanon (onon mic	mer DI, RAD, RI, OR, etc.)	
11. Check Apr	propriate Box to Indicate	Natura of Nation De	most on Other Date
NOTICE OF INT	ENTION TO.	•	_
NOTICE OF INT	ENTION TO:	Sui	BSEQUENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON 🔀	REMEDIAL WORK	ALTERING CASING
TEMPORARILY ABANDON	CUANCE BLANC	00141451105 00144111	
TEM STATE ADARDON	CHANGE PLANS	COMMENCE DRILLING	OPNS. PLUG AND ABANDONMENT
PULL OR ALTER CASING		CASING TEST AND CEN	MENT JOB
OTHER:			
		OTHER:	
<ol> <li>Describe Proposed or Completed Oper work) SEE RULE 1103.</li> </ol>	ations (Clearly state all pertinent det	ails, and give pertinent dates, i	ncluding estimated date of starting any proposed
Amoca Production Company to		1 1 1 11 11 11 11	
Amoco Production Company re	equests permission to plug an	d abandon this well per ti	
		<b>,</b>	and the second section of the section of the second section of the second section of the second section of the section of the second section of the
If you have any questins contac	t Dave Smit at (303) 830-45	:02	
, and the start quotient bounds	1 2010 Chill at (000) 000-40		
			以 E G E I V E III
			DEC 1 1 2000
			bed i i isso
			OIL COM. DIV.
	·		DIST. 31
I hereby certify that the information above	a is true and complete to the base of		A STATE OF THE STA
_ [ ] \	is true and complete to the best of f	-	
SIGNATURE TO ME	hufela	Staff Ass	DATE 12-09-1996
			DATE
TYPE OR PRINT NAME Pat Arc	huleta, Room 1205C		TELEPHONE NO. (303) 830-521
(This space for State Use)			
	) /-		
APPROVED BY Johnny (	olunson	TITL PEPUTY OIL & GAS IN	SPECTOR, DIST. #3 DEC 1 1 199
		III Brigit or a out in	DATE
CONDITIONS OF APPROVAL, IF ANY:			

Pearce GC #1
Orig. Comp. 7/65
TD = 6274', PBTD = 6230'
Page 2 of 2

- 1. Check location for anchors. Install if necessary. Test anchors.
- 2. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NUBOP.
- 3. POOH with 2 3/8" tbg. RIH with tbg and CIBP. Set CIBP at 6040'. Test csg integrity to 500#. Spot 100' cement plug on top of CIBP (13 cuft cement). Pull up hole and spot 100' cement plug across the Gallup at 5160' to 5260' (13 cuft cement), Mesaverde at 3185' to 3285' (13 cuft cement), Chacra at 2595' to 2695' (13 cuft cement), Pictured Cliff at 1597' to 1697' (13 cuft cement), Fruitland at 1285' to 1385' (13 cuft cement), Ojo Alamo at 455' to 555' (13 cuft cement), and 505' to surface (50 cuft cement).
- 4. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or State requirements.
- 5. Contact FMC and ship surface equipment to yard or other location per instructions.
- 6. Turn over to John Schwartz for reclamation.
- 7. Rehabilitate location according to BLM or State requirements.