Submit 3 Copies to Appropriate District Office	State of New Mexico Energy, Minerals and Natural Resources Department		Form C-103 Revised 1-1-89	
DISTRICT I P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATION DIVISION P.O.Box 2088		WELL API NO.	
DISTRICT II P.O. Drawer DD, Artesia, NM 882	Santa Fe, New Mexico 87	7504-2088	3004507995 5. Indicate Type of Lease	
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 8	7410	STATE FEE 6. State Oil & Gas Lease No.		
(DO NOT USE THIS FORM FOR DIFFERENT RE (FOR	NOTICES AND REPORTS ON WAR PROPOSALS TO DRILL OR TO DEEPER SERVOIR. USE "APPLICATION FOR PROPOSALS.)	7. Lease Name or Unit Agreement Name Haney Gas Com B		
1. Type of Weil: GAS			,	
WELL WELL 2. Name of Operator Amoco Production Company	Attention:	Raeburn	8. Well No. # 1	
Address of Operator P.O. Box 800 Denver	Colorado 80201		9. Pool name or Wildcat Basin Dakota	
4. Well Location Unit Letter :	1650 Feet From The South	Line and 96	60 Feet From The East Line	
Section 20	Township 29N R	ange 10 N	MPM San Juan County	
	10. Elevation (Show whether	er DF, RKB, RT, GR, etc.) 5572 'GL		
11. Check	Appropriate Box to Indicate N	Vature of Notice, Re	port, or Other Data	
NOTICE OF	INTENTION TO:	SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK	PLUG AND ABANGON X	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING	OPNS. PLUG AND ABANDONMENT	
JLL OR ALTER CASING CASING TEST AND CEMENT JOB			MENT JOB	
OTHER:		OTHER:		
 Describe Proposed or Completed work) SEE RULE 1103. Notice to P & A Well 	Operations (Clearly state all pertinent detail	s, and give pertinent dates, in	cluding estimated date of starting any proposed	

		OM TOWN		
SIGNATURE Sais A	tion above is true and complete to the	Business Asst.	DATE 02-07-1994 TELEPHONE NO. (303) 830-5294	
(This space for State Use) Original Signed APPROVED BY	by CHARLES GHOLSON	neeuty oil & gas inspector, dist. ≠		
CONDITIONS OF APPROVAL, IF ANY	e hose with mos	From 1900 TO SURFACE	NO - Necussary	

Haney Gas Com B #1 PXA Procedures

- Check location for anchors. Install if necessary. Test anchors.
- 2. MIRUSU. Blow down well. Kill if necessary with fresh water.
- 3. POOH with tbg and baker Model A-3 lockset pkr. RIH with tbg and cement retainer, set retainer at 6250'. Squeeze perfs 6306' to 6344' with 37.85 cuft cement and spot a cement plug to 5300'. (127.53 cuft)
- 4. RIH with tbg and cement retainer. Set retainer at 3400'. Squeeze casing leaks at 3460' to 4060' with 528.43 cuft cement. Pull out of retainer and spot cement plug to 3350' with 6.713 cuft of cement.
- 5. Load hole with 9ppg mud to 1900'. Spot cement plug from 1900' to surface with 255.07 cuft cement.
- 6. NDBOPE. Cut off casing and wellhead. Install PXA marker according to BLM or state requirements.
- 7. Turn over to John Schwartz for reclamation.
- 8. Rehabilitate location according to BLM or State requirements.

HANEY GAS COM B #1 Location — 201—29N—10W Basin Dakota Orig.Completion — 10/64 LAST FILE UPDATE — 1/94 BY CSW

