

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

3a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
7. Unit Agreement Name
8. Farm or Lease Name Vergie Schenke
9. Well No. #1
10. Field and Pool, or Wildcat Picture Cliff
12. County San Juan

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER Plug and Abandonment
2. Name of Operator Amenda Oil, State of New Mexico, Energy and Minerals Department
3. Address of Operator District III 1000 Rio Brazos Aztec, New Mexico 87410
4. Location of Well UNIT LETTER A 247 FEET FROM THE North LINE AND 1004 FEET FROM THE East LINE, SECTION 14 TOWNSHIP 29 North RANGE 13 West NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) Ground Level 5340'

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

08/12/86 Found well, 12 3/4" pipe with 8" casing, dug around well and welded on 9" piece of 8 5/8" casing.
08/22/86 Picked up power swivel and 1 joint tubing. Drill out to 13', sand and shale, pull out of hole.
08/23/86 Picked up power swivel and start pulling at 13', drill out top plug at 27', wash and rotate to 93'. Set swivel back and run into another plug at 207', drill out 4' plug, fell free, picked up 1 joint, another plug. Picked up swivel and drill out to 329'. Circulate hole 1 hour. Trip out of hole.
08/25/86 Trip in hole to 240', wash 4 joints to bottom, wash and drill out to 618' T.D. Lay 3 joints down, mix and spot 80 sacks Class C 3% KCl, plug. Lay down 7 joints and trip out of hole.
08/26/86 Trip in hole, tag cement at 315'. Pull out of hole and go back open ended to 125'. Mix and spot 80 sacks Class C 3% KCl cement from 125' to surface. Circulated cement.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE President DATE 9-22-86

APPROVED BY ORIGINAL SIGNED BY ERNIE BUSCH DEPUTY OIL & GAS INSPECTOR, DIST. #3 DATE SEP 23 1986
CONDITIONS OF APPROVAL, IF ANY: