UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Sundry	Notices and Reports on V	
1. Type of Well GAS		5. Lease Number SF-077092 6. If Indian, All.or Tribe Name
		7. Unit Agreement Name
Operator Meridian Oil Inc.		8. Farm or Lease Name
3. Address & Phone No. of PO Box 4289, Farmingt		Houck 9. Well No.
4. Location of Well 1850'N, 2000'E		10.Field, Pool, Wildcat Basin Dakota 11.Sec. T. R. M. or Bl
		Sec.12, T-29-N, R-10- NMPM
14. Permit No.	15. Elevations GR	12.County 13. Stat
17. Describe proposed or It is intended to repair	completed operations:	s well by the following
16. Intent to/Subsequent 17. Describe proposed or It is intended to repair procedure: TOOH w/2 3/8" tbg and iso Set retrievable bridge pl Locate failure with full Squeeze off failure with Drill out cmt & test sque Retrieve bridge plug. Land 1 1/2", 2.9#, J-55 E Swab well back into produce.	completed operations: a casing failure in this plation packer. ug at 6600'. bore packer. 50 sx Class "B" cement weeze to 1500 psi. EUE 8rd tbg near bottom p	o/2% calcium chloride. perforations.
17. Describe proposed or It is intended to repair procedure: TOOH w/2 3/8" tbg and iso Set retrievable bridge pl Locate failure with full Squeeze off failure with Drill out cmt & test sque Retrieve bridge plug. Land 1 1/2", 2.9#, J-55 E	completed operations: a casing failure in this plation packer. ug at 6600'. bore packer. 50 sx Class "B" cement weeze to 1500 psi. EUE 8rd tbg near bottom p	o/2% calcium chloride. perforations.
17. Describe proposed or It is intended to repair procedure: TOOH w/2 3/8" tbg and iso Set retrievable bridge pl Locate failure with full Squeeze off failure with Drill out cmt & test sque Retrieve bridge plug. Land 1 1/2", 2.9#, J-55 E Swab well back into produce.	completed operations: a casing failure in this plation packer. ug at 6600'. bore packer. 50 sx Class "B" cement weeze to 1500 psi. EUE 8rd tbg near bottom p	o/2% calcium chloride. perforations.
17. Describe proposed or It is intended to repair procedure: TOOH w/2 3/8" tbg and iso Set retrievable bridge pl Locate failure with full Squeeze off failure with Drill out cmt & test sque Retrieve bridge plug. Land 1 1/2", 2.9#, J-55 E Swab well back into produce.	completed operations: a casing failure in this clation packer. tug at 6600'. bore packer. 50 sx Class "B" cement we see to 1500 psi. EUE 8rd tbg near bottom paction. CUE of Affairs	erforations. 9-25-89 Date
It is intended to repair procedure: TOOH w/2 3/8" tbg and iso Set retrievable bridge pl Locate failure with full Squeeze off failure with Drill out cmt & test sque Retrieve bridge plug. Land 1 1/2", 2.9#, J-55 E Swab well back into produ	completed operations: a casing failure in this plation packer. Sug at 6600'. bore packer. 50 sx Class "B" cement we see to 1500 psi. EUE 8rd tbg near bottom processor. CUE 8rd tbg near bottom processor. CUE 8rd tbg near bottom processor. CUE 8rd tbg near bottom processor.	oerforations. 9-25-89 Date APPROVE
It is intended to repair procedure: TOOH w/2 3/8" tbg and iso Set retrievable bridge pl Locate failure with full Squeeze off failure with Drill out cmt & test sque Retrieve bridge plug. Land 1 1/2", 2.9#, J-55 E Swab well back into produce. Authorized by: Regulation Regulation Reserved by: Regulation Regulation Regulation Reserved by: Regulation Regulatio	completed operations: a casing failure in this plation packer. Sug at 6600'. bore packer. 50 sx Class "B" cement we see to 1500 psi. EUE 8rd tbg near bottom processor. CUE 8rd tbg near bottom processor. CUE 8rd tbg near bottom processor. CUE 8rd tbg near bottom processor.	perforations. 9-25-89 Date

AREA MANAGER