

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUBMIT IN TRIPLICATE\*  
(Other instructions on re-  
verse side)

Form approved.  
Budget Bureau No. 1004-0135  
Expires August 31, 1985

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> X OTHER <input checked="" type="checkbox"/>		50 MAR 24 AM 10:47	
2. NAME OF OPERATOR Meridian Oil Inc.		FARMINGTON, NEW MEXICO	
3. ADDRESS OF OPERATOR Post Office Box 4289, Farmington, NM 87499		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 1800'N, 897'W		8. FARM OR LEASE NAME Lloyd B	
14. PERMIT NO.		9. WELL NO. 3	
15. ELEVATIONS (Show whether DP, RT, OR, etc.) 5793'GL		10. FIELD AND POOL, OR WILDCAT Aztec Pic.Cliffs	
		11. SEC., T., R., M., OR BLM. AND SURVEY OR AREA Sec.1, T-29-N, R-11-W N.M.P.M.	
		12. COUNTY OR PARISH San Juan	13. STATE NM

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐  
FRACTURE TREAT ☐  
SHOOT OR ACIDIZE ☐  
REPAIR WELL ☐  
(Other) ☐

PULL OR ALTER CASING ☐  
MULTIPLE COMPLETE ☐  
ABANDON\* ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐  
FRACTURE TREATMENT ☐  
SHOOTING OR ACIDIZING ☐  
(Other) ☐

REPAIRING WELL ☐  
ALTERING CASING ☐  
ABANDONMENT\* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) \*

The following is an amended procedure for plug & abandonment:

ND WH and bradenhead.  
Install 8 5/8" x 12" nipple w/flange for BOP.  
NU BOP & test. TOOH w/2 7/8" tbg.  
TIH w/6 3/4" bit. Tag top of fish (do not drill on it).  
Wash off top of fish.  
TOOH w/bit.  
TIH w/2 7/8" overshot w/mill guideshoe on bottom and pack off rubbers (leave grapples out).  
Set overshot on fish. Space out tbg.  
Change out rams in BOP. TIH w/1 1/4" tbg. CO to 2246'. Spot 52 sx cmt. plug 2246' to 900'.  
TOOH laying down 1 1/4" tbg. TOOH w/2 7/8" and overshot. TIH w/2 7/8". Spot 25 sx. cmt. plug at top of fish (61').  
TOOH w/2 7/8".  
TIH w/2 7/8" to 150', spot 51 sx cmt. plug @ 150'. TOOH. ND BOP. Cut off casing 4' below ground. Install dry marker.  
Verbal approval for this procedure was given 3-23-88 by Steve Mason and Mark Kelly.

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE

Drilling Clerk(DM)

DATE

3-24-88

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

\*See Instructions on Reverse Side

NMCC