UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

1. Type of Well GAS	· · · · · · · · · · · · · · · · · · ·	5.	SF-078385-A
2. Name of Operator	926		Unit Agreement Na
BURLINGTON	FED 2	2 1989 💯	
3. Address & Phone No. of Operator		ik Div.	Well Name & Numbe Howell L #1
PO Box 4289, Farmington, NM 874		કિએ 9.	API Well No. 30-045-09277
 Location of Well, Footage, Sec., 990'FSL 1650'FWL, Sec.23, T-30-N, 			Field and Pool Blanco Mesaverde County and State San Juan Co, NM
12. CHECK APPROPRIATE BOX TO INDICAT Type of Submission	TE NATURE OF NOTICE, Type of Acti		DATA
X Notice of Intent	AbandonmentRecompletion	on Change of Pla New Construct	
Subsequent Report	Plugging Back Casing Repair	Non-Routine D	Fracturing
Final AbandonmentX_	Altering Casing Other -	Conversion to	o Injection
It is intended to repair the tattached procedure.	-	well according	ng to the
It is intended to repair the t	-	well according	ng to the (0.1.1.2.1 F.1.2.1)
It is intended to repair the tattached procedure.	ubing on the subject		.~
It is intended to repair the tattached procedure. 14. I hereby certify that the fore	ubing on the subject	rrect.	69 July 27 P.1 2: 16

Howell L #1

Mesaverde

990' FSL, 1650' FWL

Unit N, Section 23, T-30-N, R-8-W Latitude / Longitude: 36° 47.5543' / 107° 38.8751'

DPNO: 4798101

Tubing Repair Procedure

- Hold safety meeting. Comply with all NMOCD, BLM and Burlington safety and environmental regulations. Test rig anchors and build blow pit prior to moving in rig. Netify BROG Regulatory (Peggy Bradfield 326-9727) and the appropriate Regulatory Agency prior to pumping any cement job. If an unplanned cement job is required, approval is required before the job can be pumped. If verbal approval is obtained, document approval in DIMS/WIMS. Allow as much time as possible prior to pump time in case the Agency decides to witness the cement job.
- 2. MOL and RU workover rig. Obtain and record all wellhead pressures. NU relief line. Blow well down and kill with 2% KCL water if necessary. NU BOP with stripping head. Test and record operation of BOP rams. Have wellhead and valves serviced as necessary. Test secondary seal and replace/install as necessary.
- Mesaverde, 2-3/8", 4.7# J-55 tubing is set at 5202'. Release donut, pick up additional joints of tubing and tag bottom. (Record depth.) PBTD should be at +/- 5574'. TOOH with tubing. Visually inspect tubing for corrosion and replace any bad joints. Check tubing for scale build up and notify Operations Engineer.
- 4. If fill, TIH with 3-7/8" bit, bit sub and watermelon mill on 2-3/8" tubing and round trip to below perforations, cleaning out with air/mist. NOTE: When using air/mist, minimum mist rate is 12 bph. If scale is present, contact Operations Engineer to determine methodology for removing scale from casing and perforations.
- 5. TIH with one joint of 2-3/8" tubing with an expendable check on bottom and a seating nipple one joint off bottom then be of the 2-3/8" production tubing. Run a broach on sandline to insure that the tubing is clear. TIH with remaining 2-3/8" tubing and then broach this tubing. Replace any bad joints. CO to PBTD with air/mist. PU above the perforations and flow the well naturally, making short trips for clean up when necessary.
- 6. Land tubing at ±5356'. ND BOP and NU WH. Pump off expendable check. Connect to casing and circulate air to assure that expendable check has pumped off. Obtain pitot gauge up the tubing. If well will not flow up the tubing, make swab run to SN. RD and MOL. Return well to production.

Recommended: 10.8 the large Operations Engineer

Approved:

Bruce O. Bowy 1-6-91 Drilling Superintendent

Operations Engineer:

Mary Ellen Lutey

Office - (599-4052) Home - (325-9387)

Pager - (324-2671)

MEL/klg