

25. Trip in the hole with bit and scraper and drill out cement and pressure test casing. Re-squeeze leaks if casing fails pressure test.
26. Trip in the hole with retrieving head for RBP set in the liner, circulate sand off of RBP with 2% KCL and trip out of hole with plug.
27. Trip in hole with a sawtooth collar and/or bailer and clean out to PBTD and trip out of hole.
28. Trip in the hole with the production string (1/2 mule shoe on bottom and a seating nipple one joint off bottom), land tubing to original depth. Nipple down BOP's, nipple up well head.
29. Swab well in and put well on production.
30. Rig down move off service unit.