	UNITED STATES RTMENT OF THE INTERI		Form Epproved. Budget Bureau No. 1004-0135 Expires August 31, 1985 5. LEASE DESIGNATION AND SERIAL NO.
SUNDRY NOTICES AND REPORTS ON WELLS  (Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.  Use "APPLICATION FOR PERMIT—" for such proposals.)			14-20-603-2198  6. IF INDIAN, ALLOTTEE OR TRIBE NAME  30-045-2/6  Navajo Tribe
OIL GAS WELL X OTHER  2. NAME OF OPERATOR	NAT. ST.	Pat (1210	7. UNIT AGREEMENT NAME  8. FARM OR LEASE NAME
Dec arso space 11 below.)	Farmington, NM 87499 on clearly and in accordance with any s	State requirements.	Navajo H  9. WELL NO.  15  10. FIELD AND POOL, OR WILDCAT  West Kutz  11. SEC., T., E., M., OR M.K. AND  SURVEY OR ARMA
14. PERMIT NO.	15. ELEVATIONS (Show whether DF,		Section 13, T29N, R14W 12. COUNTY OR PARISH 13. STATE San Juan NM
16. Check	Appropriate Box To Indicate No		
TEST WATER SHUT-OFF FRACTURE TREAT SHOOT OR ACIDIZE REPAIR WOLL -Other)  17. DESCRIBE PROPOSED OR COMPLETED C proposed work. If well is direct nent 20 this work.	PULL OR AUTER CASING MULTIPLE COMPLETE ABANDON® CHANGE PLANS	WATER SHUT-OFF  FEACTURE TREATMENT SHOOTING OR ACIDIZING  (Other)  (NOTE: Report results of Completion or Recompleti details, and give pertinent dates, in one and measured and true vertical of	EEPAIRING WELL  ALTERING CASING  ABANDONMENT*  multiple completion on Well  ton Report and Log form.)  cluding estimated date of starting any depths for all markers and zones perti-
		DECEIVED N APR - 8 1997	
		OIL CON. DIV.	

\*See Instructions on Reverse Side NMOCD

## ROBERT L. BAYLESS ABANDONMENT PROCEDURE NAVAJO H NO. 15

- 1. Check for rig anchors, if necessary. Move in tank or rig pit. Haul an extra 2 joints 1 1/4" tubing to location.
- 2. Move in and rig up pulling unit. Blow well down to pit. Kill well if necessary. Rig up BOP.
- 3. Trip out and tally 1 14" tubing.
- 4. Trip in with tubing to 920', (pick up extra tubing if necessary.) Load hole with water. Spot a 4 sx. Class B cement plug. Wait on cement. Tag top of plug, (it should be at about 770'.)
- 5. Trip out laying down all but 2 joints tubing, approximately 60'. Spot surface plug of 2 sx. Class B cement.
- 6. Nipple down BOP and cut off wellhead. Install P&A marker. Rig down and move out rig. Haul away fluids as necessary. Restore location.